

JAN 10 2004



**LAND CORNER RECORDATION CERTIFICATION**  
Filling Requirement of Act 74, Mich., P.A. 1970

For corners in \_\_\_\_\_ Located in: \_\_\_\_\_ Corner Code# \_\_\_\_\_  
Lake \_\_\_\_\_  
(County)

- Public Land Survey  
T18N R14W \_\_\_\_\_ F-11  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_
- Property Controlling \_\_\_\_\_  
in Section \_\_\_\_\_  
S \_\_\_\_\_  
3. Miscellaneous \_\_\_\_\_  
Property in Sec. \_\_\_\_\_  
S \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_

RECORDED  
LAKE COUNTY, MI  
21 OCT 2003 1:01:54 PM  
SHELLY MYERS  
REGISTER OF DEEDS

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

Register of

A	B	C	D	E	F	G	H	I	J
1	2	3	4	5	6	7	8	9	10
11	12	13	14	15	16	17	18	19	20
21	22	23	24	25	26	27	28	29	30
31	32	33	34	35	36				

I, Robert L. Wetherell, in a field survey on July 18, 2003, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

F-11 1/4 Corner common to Sections 28 & 33

A. Description of original monument and accessories and/or subsequent restoration:

- 1838 S. Siblev, G.L.O.  
#1. 10" Pine N14°W, 17 Lks.  
#2. 14" Pine S34°E, 9 Lks.  
Undated Co. Survey Records  
#3. 12" W. Pine N0° 30'E 117'  
1919 G. Johnson, Co. Surveyor  
"Pipe for corner"  
#4. 6" B. Oak S19°E 28'  
#5. 8" B. Oak N37°E 32'  
1952 G. Blass, L.S. 5489  
Set 1 1/4" pipe by S.P.  
#6. 12" W. Oak N31°E 24.53'  
#7. 10" W. Oak N16°W 37.00'  
#8. 14" W. Oak S65°W 43.65'  
1964 R. Griffin, L.S. 13584  
L.C.R.C., L.01, Pg. 111  
Found 1 1/4" pipe by Blass, Set 5" Mon.  
#6. 13" W. Oak N31°E 24.81'  
#9. 7" Maple S53°E 62.02'  
#8. 16" W. Oak S65°W 44.22'  
#7. 13" W. Oak N16°W 37.64'  
#10. 1" x 16" pipe S3°W 325.23'  
(G. Johnson's incorrect corner)  
1973 C. Cole, L.S. 17615  
Survey Record L.01, Pg. 429  
Same Witnesses as Griffin  
#11. Distance West = 2665.3'  
1982 R. Wetherell, P.S. 24624  
Same witnesses as Griffin  
#12. Distance East = 2665.24'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" square concrete monument at the intersection of fences (single wire) N-S-E & W. Corner is 188' (+/-) North of center of an E-W dirt road.


Condition of Accessories: #1, Gone, #2, Gone, #3, Gone, #4, For wrong corner, #5, For wrong corner, #6 through #10, Found in good condition, #11 & #12, Did not measure.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" concrete monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 19" W. Oak S67°W 44.23' (Dock spike in SE side) #8
- 9" Maple S49°E 62.07' (Dock spike in NE side) #9
- 17" W. Oak N35°E 24.75' (Dock spike in NW side) #6
- 16" W. Oak N11°W 37.65' (Dock spike in E. side) #7
- 1" Pipe South 325.23'

Signed by Robert L. Wetherell Date OCT 3 2003  
Surveyor's Michigan License No. 24624

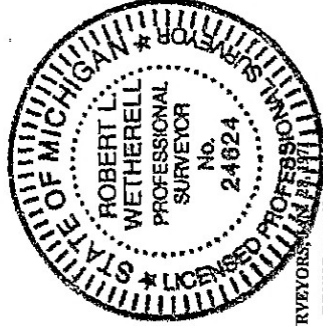

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 245  
CHAIRMAN R.W. DATE: 10/02/03

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS  
REVISED JAN. 1983  
ADAPTED FOR WORD PROCESSING JANUARY, 1999