

**SURVEY &  
REMONUMENTATION**

AUG 10 2005



**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich., P.A. 1970

For corners in \_\_\_\_\_ Located in: \_\_\_\_\_ Corner Code# \_\_\_\_\_  
Lake \_\_\_\_\_  
(County)

1. Public Land Survey T18N R14W \_\_\_\_\_ G-8  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_  
T\_N\_R\_W \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_  
in Section S \_\_\_\_\_  
3. Miscellaneous S \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, Robert L. Wetherell, in a field survey on August 5, 2004, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

G-8 ¼ Corner 21 - 22

- A. Description of original monument and accessories and/or subsequent restoration:

**1838 Sibley, G.L.O.**  
#1. 20" Pine N60°E 28 Lks.  
#2. 8" Pine S68°W 7 Lks.  
  
**1908 G. West, County Surveyor**  
"Found stump of original tree"  
#1. 28" Pine stump N60°E 28 Lks.

**1888 S. Barnett, L.S. 16923**  
L.C.R.C., L03, Pg 63  
"Found remains of pine stump and pile of stones"  
Set 5" concrete monument  
#3. 5" Oak S67°W 26.75'  
#4. 4" Oak S66°E 8.84'  
#5. 7" Oak N7°E 21.65'  
#1. Pine stump N60°E 18.48'  
#6. Carsonite post North 1.5'  
#7. Distance South = 2655.88'  
#8. Distance North = 2667.84'

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found the 5" concrete monument by Barnett and all his accessories. The corner is 34' (+/-) east of an old N-S fence.

Condition of Accessories: #1, Found remains, #2, Gone, #3, Found in good condition, #4, Found in good condition, #5, Found in good condition, #6, Gone, #7, Did not measure, #8, Did not measure.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


I accepted Barnett's 5" concrete monument as a substantial marker for the corner and is accepted as a careful and faithful perpetuation of the position of the original corner.

- |            |       |        |                          |    |
|------------|-------|--------|--------------------------|----|
| 8" R. Oak  | S74°W | 26.75' | (60 d. spike in S side)  | #3 |
| 6" R. Oak  | S64°E | 8.84'  | (60 d. spike in N side)  | #4 |
| 10" R. Oak | N9°E  | 21.75' | (60 d. spike in E side)  | #5 |
| 5" R. Oak  | S17°E | 19.06' | (60 d. spike in SW side) |    |

Signed by Robert L. Wetherell Date 10-18-04  
Surveyor's Michigan License No. 24624

RATIFIED BY THE LAKE CO. FEEB REVIEW  
GROUP IN ACCORDANCE WITH P.A. 345  
CHAIRMAN RAW DATE 10-12-04

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971  
REVISOR ROBERT WETHERELL  
REVISION NOVEMBER 1998

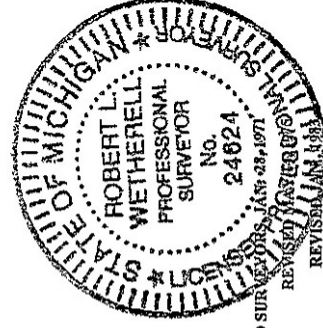

Liber **5** Page **323**

RECORDED  
LAKE COUNTY, MI  
18 OCT 2004 2:34:22 PM

SHELLY MYERS  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5			4			3				2	
3													
4	7		8			9			10			11	12
5													
6	18		17			16			15			14	13
7													
8	19		20			21			22			23	24
9													
10	30		29			28			27			26	25
11													
12	31		32			33			34			35	36
13													