

AUG 10 2005



SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich., P.A. 1970

For corners in
Lake _____
(County)

Located in: _____ Corner Code# _____

1. Public Land Survey
T18N R14W _____
T_N_R_W _____
T_N_R_W _____
T_N_R_W _____
2. Property Controlling
in Section
S _____
S _____
S _____
S _____
3. Miscellaneous
Property in Sec. _____

Liber **5**

Page **324**

RECORDED
LAKE COUNTY, MI
18 OCT 2004 2:34:22 PM

SHELLY MYERS
REGISTER OF DEEDS

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1	2	3	4	5	6	7	8	9	10	11	12	13
1	2	3	4	5	6	7	8	9	10	11	12	13
14	15	16	17	18	19	20	21	22	23	24	25	26
27	28	29	30	31	32	33	34	35	36	37	38	39
40	41	42	43	44	45	46	47	48	49	50	51	52

I, Robert L. Wetherell, in a field survey on August 3, 2004, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

H-9 ¼ Corner 22 - 27

A. Description of original monument and accessories and/or subsequent restoration:

- 1938 Sibley, G.L.O.
#1. 8" Pine N13°W 8 Lks.
#2. 6" Pine S43°E 13 Lks.
- 1957 G. Blass, L.S. 5489
Set Corner (1" pipe) by single proportionate method (2677.22 each way)
#3. 14" W. Oak N41°E 17.13'
#4. 8" W. Oak S71°W 28.80'
#5. 7" W. Oak N18°W 8.33'
- 1964 R. Griffin, L.S. 13584
L.C.R.C. L.01, Pg. 121
Found 1" Pipe - Set 5" Concrete monument
#3. 12" W. Oak N41°E 17.60'
#6. 5" W. Oak S23°E 63.48'
#4. 9" W. Oak S71°W 29.00'
#5. 8" W. Oak N18°W 8.63'
#7. Post North 1.4'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" concrete monument on the East face of a large hill. It checked well with all the recovered witnesses.

Condition of Accessories: #1, Gone, #2, Gone, #3, Found in good condition, #4, Found dead, #5, Found dead, #6, Gone, #7, Found in good condition.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted Griffin's 5" Concrete monument as a substantial marker for the corner as a careful and faithful reestablishment of the position of the original corner.

- | | | | | |
|------------|-------|--------|--------------------------|----|
| 16" W. Oak | N47°E | 17.55' | (Dock spike in SE side) | #3 |
| 19" R. Oak | S16°W | 59.78' | (60 d. spike in E side) | |
| 8" R. Oak | S52°W | 31.48' | (60 d. spike in SE side) | |
| 4" Maple | N24°E | 27.52' | (60 d. spike in W side) | |

Signed by Robert L. Wetherell Date 10-18-04

Surveyor's Michigan License No. 24624

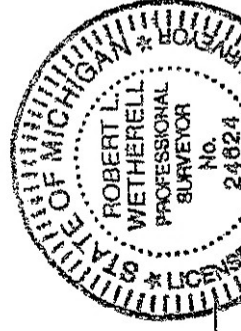

RAITIFIED BY THE LAKE CO. PEER REVIEW
GROUP IN ACCORDANCE WITH P.A. 345
CHAIRMAN R. Hall DATE: 10-12-04

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 23, 1997
REVISED JAN 11, 1997
REVISED JAN, 1983

ADAPTED FOR WORD PROCESSING JANUARY, 1999