

**SURVEY &
REMONUMENTATION**

AUG 31 1999

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

RECORDED
LAKE COUNTY, MI.

LIBER 004 PAGE 0217

For corners in

Lake _____ Located in: _____ Corner Code# _____

JUL 23 3 07 PM '99

Robert L. Wetherell

REGISTER OF DEEDS

1. Public Land Survey _____ Located in: T 18N _____ Corner Code# R14W _____ I-9
 T _____ R _____
 T _____ R _____
 T _____ R _____
2. Property Controlling S _____ T _____ R _____
 in Section _____
 S _____ T _____ R _____
3. Miscellaneous _____ T _____ R _____
 Property in Sec. _____
4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Robert L. Wetherell, in a field survey on January 20, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

I-9 - Sec. Corner common to Sections 22, 23, 26 & 27, T18N, R14W

A. Description of original monument and accessories and/or subsequent restoration:

- 1838 - S. Sibley, G.L.O.**
 #1 - 8" W. Oak N78°W 19 Links
 #2 - 10" Pine S56°E 44 Links
- 1905 - R. Hollister**
 #3 - 15" Pine Stump N8-1/2°E 23 Links
- 1957 - G. Blass, I.S. 5489**
 Found 1/2" x 30" Pipe
 #4 - 8" W. Oak N75°E 66.50'
 #5 - 18" R. Oak S16°E 7.05'
 #6 - 14" W. Oak S65°W 41.80'

- 1964 - R.A. Griffin, I.S. 13584**
 L.C.R.C. - L. 01, Pg. 127
 Found 1/2" x 30" Pipe (replaced with
 5" Square Concrete Monument).
 #4 - 11" W. Oak S74°E 66.82'
 #7 - 7" W. Oak S64°E 108.95'
 #5 - 18" B. Oak S19°E 7.33'
 #6 - 13" W. Oak S52°W 42.13'
 #8 - 8" B. Oak N22°W 42.13'
 #9 - 5" x 7' Post North 1.6'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" Square Concrete Monument in the Southwest corner of a pine plantation.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found in good condition, #7 Found in good condition, #8 Found in good condition, #9 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 16" W. Oak S58°W 42.47' (60d spike in N. side) #6
- 12" B. Oak N20°W 97.62' (dock spike in W. side) #8
- 3" W. Pine S10°W 30.57' (60d spike in W. side)
- 11" W. Oak N65°W 49.38' (60d spike in N. side)

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP
 IN ACCORDANCE WITH P.A. 345
 CHAIRMAN *R.W.*
 DATE 7-20-99

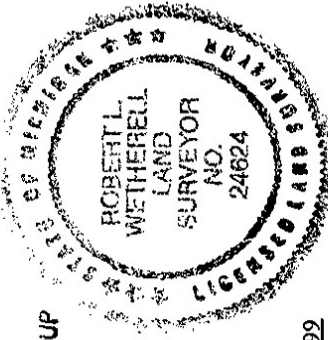

Signed by Robert L. Wetherell

Surveyor's Michigan License No. 24624

Date July 21, 1999

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3	7	8	9	10	11	12							
4	18	17	16	15	14	13							
5	8	19	20	21	22	23	24						
6	10	30	29	28	27	26	25						
7	11	12	31	32	33	34	35	36					

Register of Deeds Stamp & File Number