

AUG 10 2005

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich., P.A. 1970

For corners in _____
Lake _____
(County)

Located in: _____ Corner Code# _____

- Public Land Survey
T18N R14W _____ I-10
T_N_R_W _____
T_N_R_W _____
T_N_R_W _____
S _____
S _____
S _____
S _____
- Property Controlling in Section _____
- Miscellaneous Property in Sec. _____

- Lot No. _____, Recorded Plat _____
- Private Claims _____

I, Robert L. Wetherell, in a field survey on August 5, 2004, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

I-10 ¼ Corner 26 - 27

- Description of original monument and accessories and/or subsequent restoration:

1838 Sibley, G.L.O.
#1. 8" Pine N86°W 10 Lks.
#2. 6" Pine S37°E 17 Lks.

1905 R. Hollister, Co. Surveyor
Unrecorded Survey
Distance North to 1/16 Corner = 1320'
Distance East to C ¼ = 2732.40'

1957 G. Blass, L.S. 5489
Section map indicates corner is ½ way and on line between section corners (2712.14' each way)

- Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I was unable to recover any monument for this corner. I searched for Hollister's 1/16 corner to the North, but found nothing. I set the corner by single proportionate method, in accordance with Blass' survey of 1957. I measured the mile at 5427.20' - setting the ¼ corner at 2713.60' each way.


Condition of Accessories: #1, Gone, #2, Gone.

- Description of monument for corner and accessories established to perpetuate locating the position of the corner.

I set a ¾" x 24" re-bar with Lake Co. Remon cap and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 11" W. Oak S51°E 11.55' (60 d. spike in NE side)
- 12" W. Oak S35°W 49.65' (60 d. spike in NW side)
- 8" W. Pine N37°W 12.90' (60 d. spike in SW side)
- 8" W. Oak N39°E 45.11' (60 d. spike in E side)

Signed by Robert L. Wetherell Date 10-18-04
Surveyor's Michigan License No. 24624

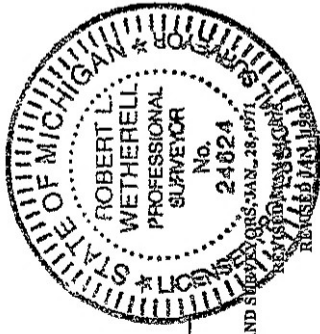

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345
CHAIRMAN R.W. DATE: 10-12-04

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS

ADAPTED FOR WORD PROCESSING JANUARY, 1999



Liber 5 Page 326

RECORDED
LAKE COUNTY, MI
18 OCT 2004 2:34:24 PM
SHELLY MYERS
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1	2	3	4	5	6	7	8	9	10	11	12	13
14	15	16	17	18	19	20	21	22	23	24	25	26
27	28	29	30	31	32	33	34	35	36			