

MAR 08 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A.-1870

For corners in

MASON Located In: Corner Code: 11

1. Public Land Survey

T 19N R 15W
T 19N R 15W
T 19N R 15W

G-1
H-1

2. Property Controlling

S

in Section

S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. Recorded Plat

5. Private Claims

FILED

AT 10:45 O'CLOCK G M

NOV 1 1993

MARY GOLDEN KOLASKI
MASON COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. John Schulke in a field survey on Oct., 22nd & 25th 1993

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land and Surveyors or by a Decree of a Court of Law; established, re-established, re-monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A Description of original monument and accessories and/or subsequent restoration:

G-1 H-1
In 1838, Sibley established 12" dia. Not a government corner.

cedar tree as the corner. G-13
Southwest corner of Section 34,
T20N, R15W) is 17 lks. West of tree.
to BT.


I-1
In 1838, Sibley established 9" dia. cedar tree as the corner. I-13 (Southeast corner of Section 34, T20N, R15W) is 29 lks. West of tree. No BT

In 1979, K. Ross found well point at the corner. The Southeast corner of Section 34 (T20N, R15W) West a distance of 18.87 ft. of I-1.

In 1983 R. Griffin, replaced well point with 5"X60" concrete monument with a brass cap stamped to identify the corner. Set Fiber-

CONTINUE ON BACK

B Description of corner evidence found and/or method applied in restoring or reestablishing corner:
G-1 H-1
No GLO evidence found. Established Not previously established.
G-13 (see 1993 corner certificate
G-13, T20N, R15W).

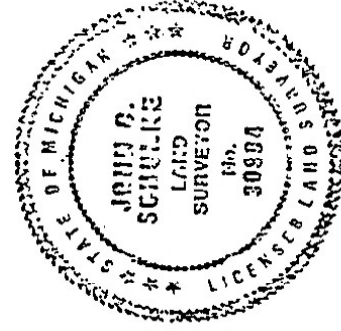

C Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-1 H-1
Restored by measuring S89°54'E a Established on the line between
distance of 11.22 ft. from restored H-13 (North 1/4 corner of Section
-13 (Southwest corner of Section 34, T20N, R15W) and I-13 (South-
4, T20N, R15W) and on line with east corner of Section 34, T20N,
-13 (Southeast corner of Section R15W) and for distance at the mid-
4). Set 2 1/2" dia. X 30" iron point between G-1 (Northwest corner
pipe with a brass cap stamped to of Section 3) and I-1 (Northeast
identify the corner. Set fiberglass corner of Section 3). Set 2 1/2"
post 1.0 ft. NE of the corner dia. X 30" iron pipe with a brass
the following corner references: cap stamped to identify the corner.
Oak 7" S75°E 58.59 ft. Set fiberglass post 1.5 ft. East
Pine 8" N42°E 7.42 ft. of the corner. The South 1/4
Pine 8" S16°W 50.47 ft. of Section 34, T20N, R15W bears
Maple 6" S64°W 26.60 ft. N89°54'W a distance of 15.07 ft.
CONTINUE ON BACK

I-1
The following new corner references:
Hemlock 14" N81°E 15.28 ft.
Hemlock 16" N22°W 45.43 ft.

Signed by *John B. Schulke* Date *Nov 9, 1993*

Surveyor's Michigan License No. RLS-30894

For Group Reviewed

and Approved

Date: *11-9-93*

Kenneth L. Rice
Mason County Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1981

LIDER

3 PAGE