

Record

Geometric ILI Summary Document

Line 5 ENO-EMA Apr 18, 2018 BH Geopig

Effective Date: <7/13/2018>

Version #: <1.0>

Version Date: <7/13/2018>

Uncontrolled Copy if Printed

Confidential Business Information – **Internal Use Only – Restricted Distribution**

External Distribution Requires Prior Written Approval by the Law Department

Table of Contents

1.0 Purpose 3
2.0 Scope 3
3.0 Basic Inspection Remarks 3
4.0 Inspection Report Review (PI-47) and Remarks 4
5.0 Priority Notification for Imperative Condition 6
6.0 Back to Back Inspection Comparison ..... **Error! Bookmark not defined.**
7.0 Summary of Feature Selection 7
7.1 Summary of Features Meeting Code Criteria (PI-43) 7
7.2 Summary of Features Meeting Investigative Criteria (PI-43) 7
7.3 Total Dig Selection Summary 8
8.0 Features Identified Through Data Integration (PI-32) 8
9.0 Graphical Representation of the Integrity Status of the Line 10

Confidential Business Information – **Internal Use Only – Restricted Distribution**
External Distribution Requires Prior Written Approval by the Law Department

1.0 Purpose

This document will provide a summary of all aspects associated with the deformation program. Contents of this summary may include but it is not limited to:

- ILI QA/QC results and remarks
- Summary of preliminary results, as well as learnings from previous excavation program
- Summary of preliminary field results and trending (if available)
- Back to back ILI inspection comparison
- Summary of priority notification features
- Summary of pressure restrictions associated with geometric features reported by the Inspection
- Summary of geometric features meeting “Code Criteria” as per Table 3 of PI-43
- Summary of geometric features meeting “Investigative Criteria” as per Table 4 of PI-43
- Summary of geometric features identified through threat integration
- List of geometric feature selected for detail feature review
- Risk mitigation assessment data.

It is important to consider that this document is a working file that tracks learnings and/or status of the deformation program. Therefore, all changes to the selection process should be included in the corresponding sections and a clear summary of the learnings and resultant actions should be documented within this document.

2.0 Scope

This record applies to the ILI reports indicated on the front page of this document. This document will reference Pipeline Integrity (PI) procedures as part of the Fitness for Service (Offs) process defined further in Integrated Management System IMS-09.

3.0 Basic Inspection Remarks

Please indicate in this section important information regarding the inspection; contents of this section include but are not limited to:

- This is the sixth geometry inspection on the East Straits
- The last two geometric inspections were in 2017 and 2016; as per the PIPES ACT, the Straits will have annual corrosion and geometry inspections starting in 2016

Uncontrolled Copy if Printed

Confidential Business Information – **Internal Use Only – Restricted Distribution**
External Distribution Requires Prior Written Approval by the Law Department

Table 1 Inspection Parameters

ILI inspection Parameter	Absolute units (in)	Alternative
Sizing accuracy	± 0.1	± 0.5 % OD
Orientation accuracy	NG	NG
Reporting Threshold	± 0.1	± 0.5 % OD
Minimum deformation detection threshold	0.1	0.5 % OD
Circumferential sensor/arm spacing	0.4	50 sensors

- This inspection is considered to be a high resolution inspection level 2 (please note high resolution inspection level 1 is a circumferential spacing less than 25.4 mm (1 in), level 2 greater than or equal to 25.4 mm (1 in) and less than 50.8 mm (2 in), and level 3 greater than or equal to 76.2 mm (3 in))[1]

[1] Please note that the resolution levels defined is this document does not correspond to any industrial standard classification and have been defined for Enbridge internal use only.

4.0 Inspection Report Review (PI-47) and Remarks

Complete the review of the ILI report as per guidelines of PI-47

1. Was this a degraded inspection?

☒ No

☐ Yes

Inspection Summary

Operational Details

Baker Hughes Pipeline Inspections has mobilized equipment and a qualified crew to perform in-line inspections of the following system:

BHI Job Number	J2008-358
Pipeline Operator	Enbridge Energy, Limited Partnership
Segment Name	Line 5 North Straits EAST - Mackinaw
Launch Site	Ignace, Michigan
Receive Site	Mackinaw City, Michigan
Pipeline Nominal Diameter	20"
Product	Oil
Section Length	4.13mi
Date of GEMINI™ Inspection	April 17, 2018
Duration of GEMINI™ Inspection	1 hour 57 minutes
Field Project Manager	Dale Simpson

Table 1. Operational Details

After passing all of the Baker Hughes pre-run inspection procedures, the GEMINI™ was launched at 13:16 EDT on April 17, 2018. The tool entered the receive trap at 15:13 EDT on April 17, 2018. The GEMINI™ tool was received relatively clean with 1 damaged Caliper sensor arm.

Field analysis indicated that a 98.24% of caliper data was collected for the run. 1 Caliper sensor arm was damaged after passing a tee at launch. But this didn't affect the sizes of the reported geometry anomalies. All other systems, including Inertial, odometer, pressure and temperature sensors functioned normally for the entire run.

Based on the vendor's inspection summary shown above, one caliper sensor arm was damaged during the inspection. No geometric anomalies were reported in affected areas by the previous March and April 2018 caliper inspections.

2. Are there features meeting immediate reporting requirements not previously reported?

☒ No
☐ Yes

3. Is reported feature density what was expected?

☒ Yes
☐ No

4. Do reported features align with known existing features?	☒ Yes ☐ No
5. Based on Report Review, is the inspection acceptable for further analysis?	☒ Yes ☐ No

5.0 Priority Notification for Imperative Condition

Were there any features reported meeting imperative condition?	☐ Yes ☒ No
Were there any features not reported as imperative condition that meet the imperative condition criteria?	☐ Yes ☒ No

Confidential Business Information – **Internal Use Only – Restricted Distribution**
External Distribution Requires Prior Written Approval by the Law Department

6.0 Summary of Feature Selection

6.1 SUMMARY OF FEATURES MEETING CODE CRITERIA (PI-43)

Table 2 summarizes all features meeting the code criteria as defined by PI-43.

Table 2 Features meeting code criteria

Category	Sub-Category d = depth D = Diameter	Number of Features Reported	Number of Features Issued for Excavation
Topside Dent Features	d > 6%	0	0
	D < 12", d > 0.250" D ≥ 12", 6% ≥ d ≥ 3%	1	0
	D < 12", d = 0.250" D ≥ 12", 3% > d ≥ 2%	0	0
	Associated with metal loss, cracking, or stress concentrator	0	0
Bottom Side Dent Features	Bottom of pipe dent, d > 6%	0	0
	Associated with metal loss, cracking, or stress concentrator	0	0
Dents Affecting Pipe Curvature at a Weld	D < 12", d > 0.250" D ≥ 12", d ≥ 2% Associated with girth weld	0	0
	D < 12", d > 0.250" D ≥ 12", d ≥ 2% Associated with long seam weld	0	0
Totals		1	0

The 3.34% OD topside dent is a result of the April 2018 anchor strike and has already been inspected by ROV and divers; a dent was confirmed with two minor gouges in it (no cracking was identified). The gouges were hand filed and removed at < 10% NWT. Additionally, one mill surface irregularity and two linear features, not associated with the dent, were filed down and removed. There are no longer any surface indications present. This plain dent was issued for excavation as part of the April 7, 2018 Geopig program and will be repaired with a composite wrap repair and recoated.

6.2 SUMMARY OF FEATURES MEETING INVESTIGATIVE CRITERIA (PI-43)

Table 3 summarizes all features meeting the investigative criteria as defined by PI-43.

Confidential Business Information – **Internal Use Only – Restricted Distribution**
External Distribution Requires Prior Written Approval by the Law Department

Table 3 Features meeting investigative criteria (PI-43)

Category	Sub-Category/Comments	Number of Features Reported	Number of Features Issued for Excavation
Other Features of Interest	Top of pipe geometric anomalies in close proximity (within 10' axial and 60° radial positions)	0	0
	Bottom of pipe dents or geometric anomalies in Close Proximity (within 5' axial and 60° radial positions)	0	0
	Multiple Apex Dent	0	0
	Other dent/geometry features of interest including buckles, wrinkles and ovalities (Ovalities excavation selection based on Minimum Allowable ID as per OMM Book 3 05-03-03)	0	0
Interacting Features Identified Through Threat Integration Processes	Dent with possible stress concentrator	0	0
Totals		0	0

6.3 TOTAL DIG SELECTION SUMMARY

Table 4 Total number of digs selected based on Code Criteria and Investigative Criteria

Criteria	Number of Features Reported	Number of Features Issued for Excavation
Code	1	0
Investigative	0	0
Totals	1	0

7.0 Features Identified Through Data Integration (PI-32)

Please include in Table 5 all features that have been identified as potential associated with secondary feature. Also, indicate which features require detail feature review. It is important to note that all features identified as requiring detail feature review should be included in the detail feature review document.

Table 5 List of Features Identified as Potentially Associated with Metal Loss Indications Through Data Integration (PI-32)

No interacting features based on the latest threat integration.

Feature ID	GW Number	Actions and Remarks	Detail Feature Required (Y/N)
NA			

Confidential Business Information – **Internal Use Only – Restricted Distribution**
External Distribution Requires Prior Written Approval by the Law Department

8.0 Graphical Representation of the Integrity Status of the Line

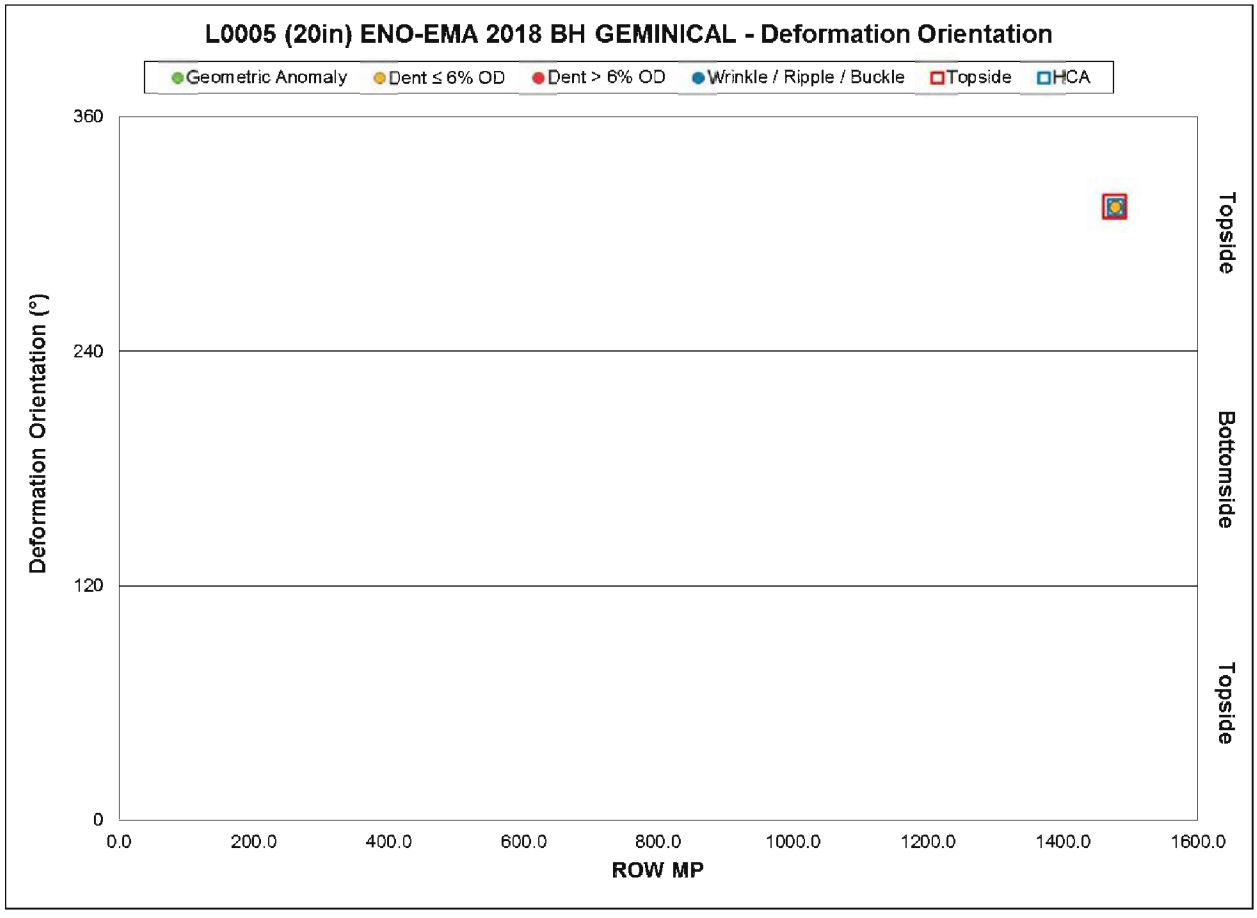


Figure 1 Orientation of all reported deformation features on the pipeline system based on the 2018 Geopig program.

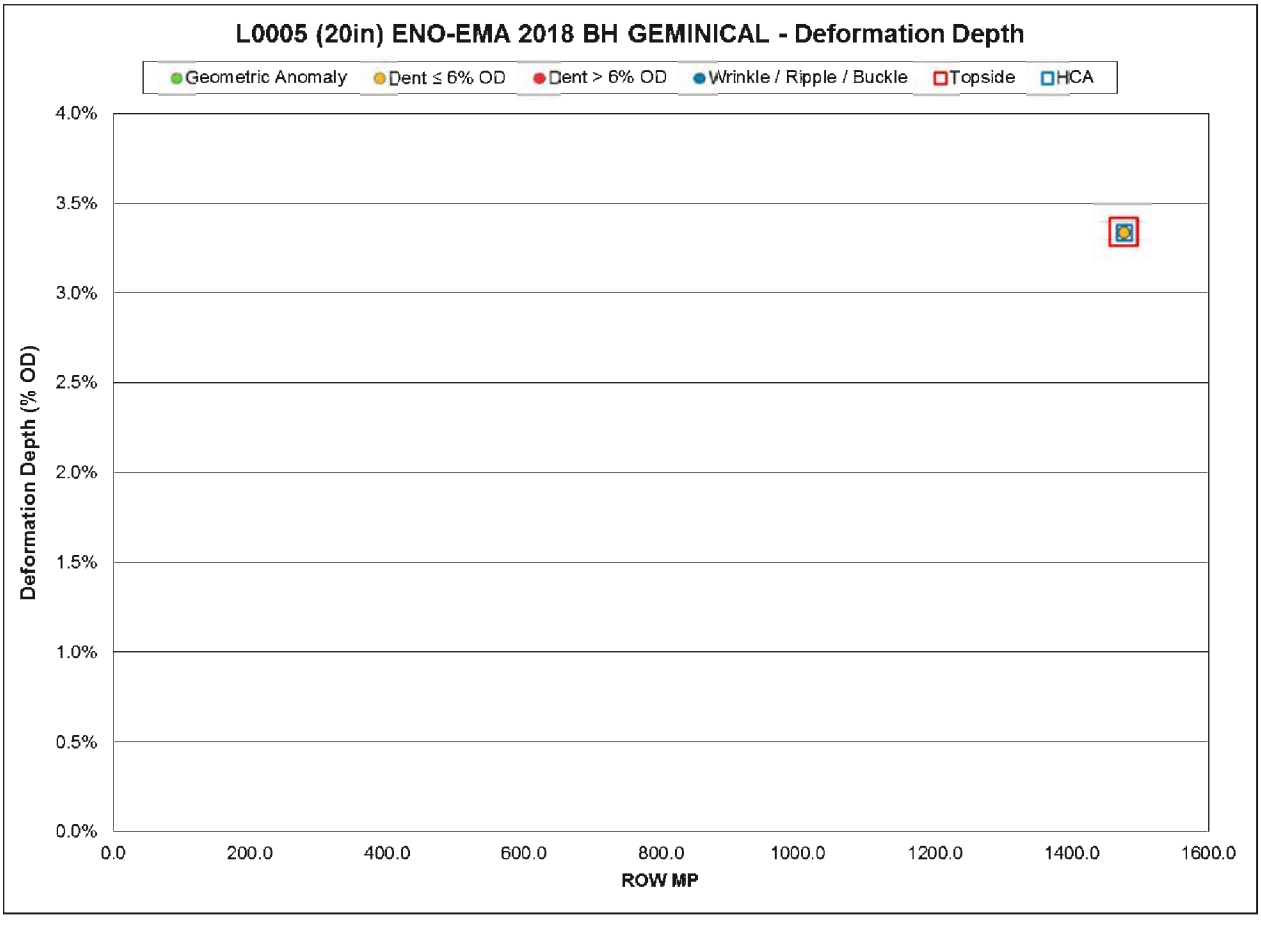


Figure 2 Depth of all reported deformation features on the pipeline system based on the 2018 Geopig program.

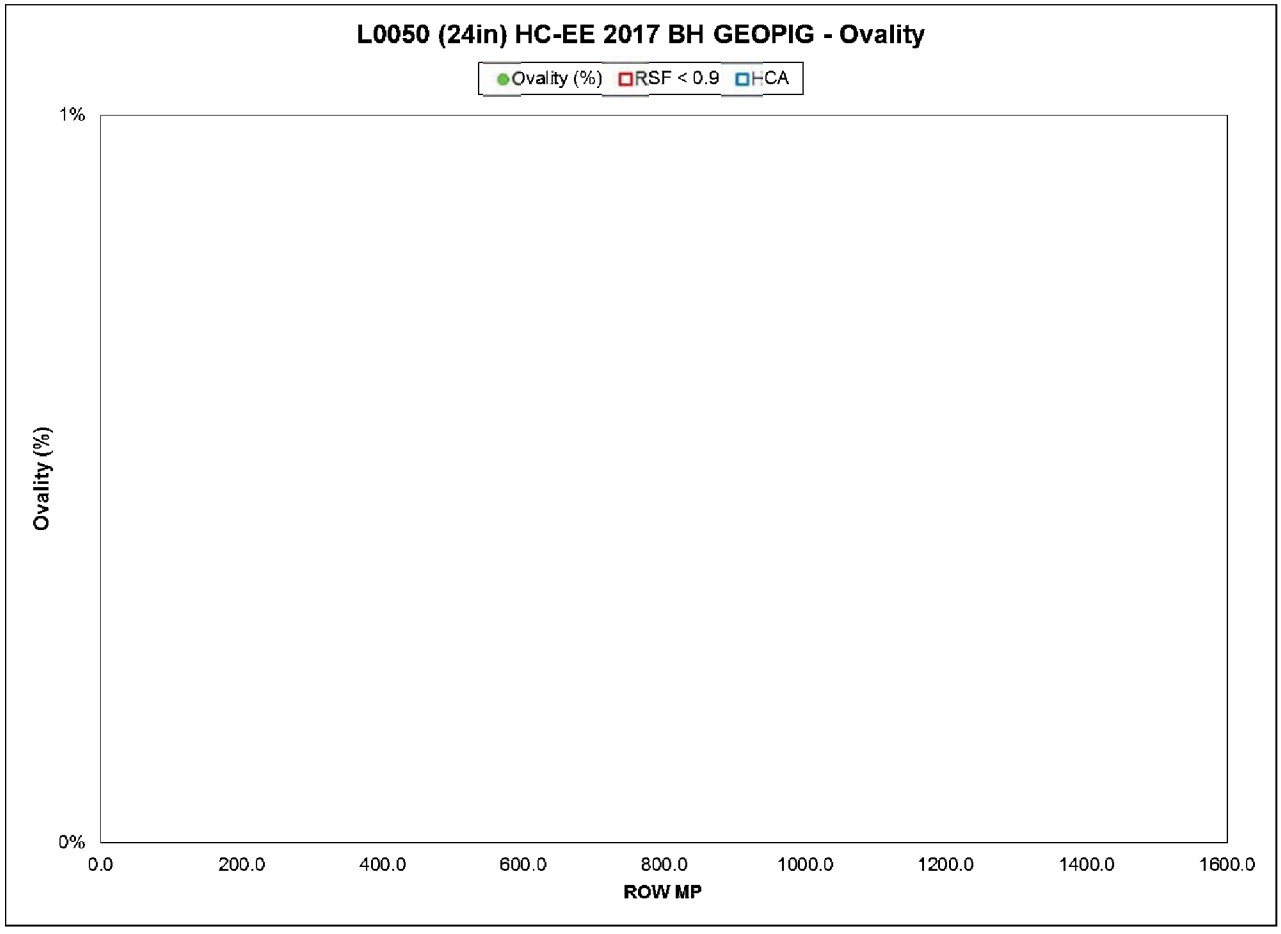


Figure 3 Severity ranking of all reported ovality features on the pipeline system based on the 2018 Geopig program.