

Part B: Surveyor's Report on Perpetuation or Monumentation of Corner(s)

F-5, Being the ¼ corner common to Sections 9 and 16, T22N, R12W.

Found remains of P.K. Nail as per R. Mitchell (2009). Corner fits Plat of Doruise Airport Estates Subdivision. The corner is accepted as a careful and faithful reestablishment of the position of the original corner. Set 5/8" x 36" Iron with Wexford County brass cap in monument box.

Distance to E-5, 2644.02'-Grid; 2628.78'-GLO; 2644.08'-USFS; 2644.0'-JLH (Plat of Doruise Airport Estates Subdivision); 2644.30'-JAR


Distance to G-5, 2644.25'-Grid; 2628.78'-GLO; 2644.21'-USFS; 2644.31'-CJP; 2644.37'-TGH; 2644.0'-JLH; 2644.30'-JAR.

Part C: Field Evidence of Perpetuation or Monumentation of Corner(s)

F-5, Being the ¼ corner common to Sections 9 and 16, T22N, R12W.

Set 5/8" x 36" Iron with Wexford County brass cap stamped 2015, 9 & 16, JAR, 25869

N35°E 63.10' 30" Maple (7)
N73°E 95.99' Power Pole (6)
S49°E 70.94' 15" Maple (Dead) (10)
S12°E 34.37' Power Pole (5)
N04°E 38.68' 9" Jack Pine (8)


L: 8 P: 226 201500006856
COR Fee: \$ 17.00
11/19/2015 09:59 AM Page: 2 of 2
Lorie L. Sorensen
Register of Deeds - Wexford County, MI


Date of Observation	Latitude	Longitude	Datum and Adjustment Year	Epoch Date
September 24, 2015	N 44°18'33.16"	W 85°46'15.90"	NAD83 (2011)	2010.00

Method: GPS Network real-time position survey to MDOT CORS.

Disclaimer: The Latitude and Longitude reported hereon was observed using global positioning methods with an estimated positional accuracy of 1 foot, more or less, reported at time of observation. The reported Latitude and Longitude is a navigational accessory to the approximate corner location and shall not be used to reestablish the corner position or used in establishing property boundaries.

I, James A. Ray, in a field survey on August 10, 2015, certify under the requirements of the State Survey and Remonumentation Act, 1990 PA 345, MCL 54.261 to 54.279, and the Corner Recordation Act, 1970 PA 74, MCL 54.201 to 54.210d, that the corner(s) identified and described hereon has been perpetuated or monumented as described in Parts A, B, and C above, pursuant to the laws and rules of the State of Michigan.

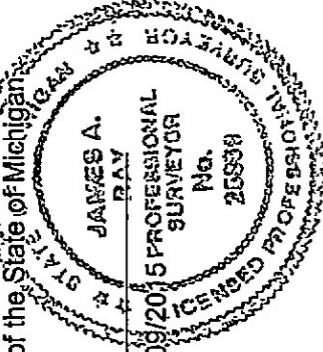

James A. Ray
Professional Surveyor's License No.: 25869

Axin Land Surveys, Inc., 811 Sunnyside Drive, Cadillac, MI 49601

I, Craig J. Pullen, state that the corner(s) identified and described hereon and perpetuated or monumented as described in Parts A, B, and C above was presented to and reviewed by the Peer Review Group on 10/09/2015 and is accepted for filing in the Wexford County Remonumentation Program.


Craig J. Pullen
Professional Surveyor's License No.: 39095
Date: 11-13-15