

SURVEY & REMONUMENTATION

CHEBOYGAN COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **MAR 13 2002**

RECEIVED
FOR RECORD

01 NOV -7 PM 1:40

CHEBOYGAN
(County) **SECTION**

Located In:

Corner Code #

1. Public Land Survey

T 37NR 2W

B-3

2. Property Controlling
in Section

S

T R

3. Miscellaneous

S

T R

Property in Sec.

S

T R

Mary Ellen Lydon
CLERK/REGISTER
CHEBOYGAN COUNTY MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, JAMES H. GRANGER, in a field survey on SEPTEMBER 25, 20 01 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


1856 GLO Resurvey
Harvey Mellen

Set wood post

10" Tamarack N86°W 21 lks
6" Tamarack N20°W 7 lks

1985 Survey Notes
Orlando Doyle #7319

Indicates 1" pipe
4 witnesses

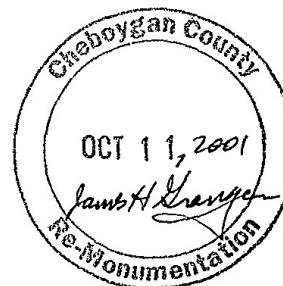

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1" pipe. Found 2 blazed trees with overgrown witness tags and 2 other witnesses. Measured distance from SW to SE Sec. corners. Ex. pipe fits well with halfway between Sec. corners but lies approximate 16 ft. N. of straight line. Several property surveys tied to ex. pipe. No evidence of GLO found. Accepted position as established.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 30" rebar with aluminum Remonumentation cap

4" Tamarack N24°E 15.09' Fd nail

4" Tamarack N73°E 11.77' Fd nail

6" Tamarack S28°E 21.73' Fd overgrown nail & washer, set nail & cap #16041

6" Tamarack S16°W 28.78' Fd overgrown nail & washer, set nail & cap #16041



LIBER 012 PAGE 39

Signed by

James H. Granger

Date October 31, 2001

Surveyor's Michigan License No. 16041