

SURVEY & REMONUMENTATION

FEB 08 2008



DELIVERED TO NEWAYGO CO. 01/22/2008 3:43:01 PM

SECTION

2007 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Newaygo (County)

Located in: Corner Code #

VOL. 5 349

1. Public Land Survey

T13N R11W E-6
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W

2. Property Controlling in Section S
3. Miscellaneous S
Property in Sec. S



LINDA M. LANDHEER NEWAYGO COUNTY REGISTER OF DEEDS RECEIVED AND RECORDED 01/22/2008 4:03:22 PM

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

Table with columns A-M and rows 1-13. Row 6, column 17 contains a black dot.

I, Norman L. Ochs, In a field survey on November 8, 2007 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Quarter corner common to Sections 16 and 17, Big Prairie Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO - James H. Mullett 4th Quarter 1837
Set quarter section post
#1 12" White Oak S55°E 50 links (33.0')
#2 8" White Oak S79°W 30 links (19.80')

William M. Jacques, County Surveyor
Book B, Pages 34 and 35, 1908
Iron Corner

OVER

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:


I found a 1" x 16" iron pipe, 6"± below bituminous. I also found a 6" diameter vitrified clay concrete filled tile 26" long with +- 10"± below grade. The centerline of North and South bituminous road is 2'± East of the corner. The corner is online ± with centerline of East and West gravel road. The condition of the witnesses are as follows: #1 and #2 gone, #3 and #4 good, #5 gone, #6 found Top Center phone riser (leaning NE) S40°E 50.85', #7 probably same as #4, but W. Fries has an incorrect distance, #8 gone, #9 thru #11 good.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I referenced position and removed iron pipe and clay tile prior to road project. After completion of road project I set a 4" diameter Harrison cast iron monument 20" long marked "County Surveyor #22439" at the location of the iron pipe, in a monument box as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original quarter corner.

#3 SW corner of block foundation of Church N45°E 66.17'
#4 26" White oak N72°E 96.24'
#9 Letter "O" in front of fiberglass pad of phone switching station S40°W 53.08'
Light Pole S47°E 54.02'
30" White Oak N73°W 74.50'

Found spike with tag #30389 in West side
Found spike with tag in NE side
Set 40d spike with tag in South side

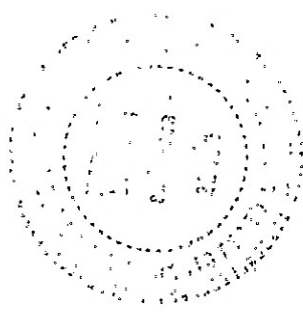

Signed by Norman L. Ochs
Norman L. Ochs

Date January 14, 2008

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on November 28, 2007
Norman L. Ochs, County Representative.

M.L.O.