

SURVEY &
REMONUMENTATION

SEP 11 2007

SECTION



OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

OSCODA _____
(County)

Located In: _____ Corner Code # _____

1. Public Land Survey T26N R1E G-5 _____

2. Property Controlling S _____
in Section S _____

3. Miscellaneous S _____
Property in Sec. S _____

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Marvin E. Myers, P.S., in a field survey on June 4, 2007 _____ 20 07

I do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-5 Section Corner common to Sections 9, 10, 15, & 16 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set post Corner Sections 15, 16, 9, 10

Wit: Aspen 4" N05 ½°E 10 lks (6.60)

Spr Pine 6" S07°W 28 lks (18.48)

4" Spr Pine North 205 lks (135.3)

7" Cedar West 253 lks (166.98)

1887 Oscoda County Surveyor John Randall

Mon.- Set Cor 9-10-16-15

Wit: Cedar 12" S63°E 65 lks (42.90)

Tam 8" N52°W 14 lks (9.24)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-5 Section Corner common to Sections 9, 10, 15, & 16 of T.26N.-R.1E.

Found USGLO monument with brass cap; found 16" Cedar N24°E 15.7; found 10" Cedar (down) S37°W 33.33; found 10" Cedar N36°W 44.55; found 14" Cedar S22°E 8.7; found bar and cap #12018 West 66.00; found 8" Cedar N12°W 19.2 Accepted USGLO monument as a careful and faithful reestablishment of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
G-5 Section Corner common to Sections 9, 10, 15, & 16 of T.26N.-R.1E.

Mon - USGLO concrete monument with brass cap placed two spikes along side for magnetic attraction.

Wit: 13" Cedar N30°E 14.95

14" Cedar S24°E 9.18

9" Cedar N08°W 19.00

Cedar post with location post N50°W 1.31

Set nail & tag in S side 7" Twin Cedar N57°W 24.98

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	13	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


OSCODA COUNTY
JERI WINTON
OSCODA COUNTY
REGISTER OF DEEDS
08/29/2007 10:08:52AM
FEE: \$17.00
PAGES: 2 RCPT#: 5761
LC8-108 CORNER RECORDATION

APPROVED

County Remonumentation

Peer Review Group

NCC 25 AUG 07

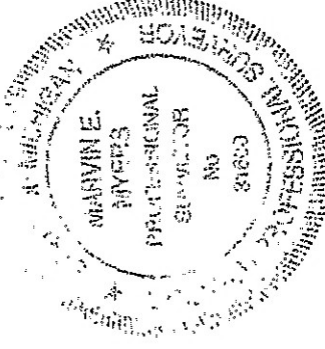

Signed by Marvin E. Myers
Surveyor's Michigan License No. 31600

Date July 27, 2007