

SURVEY &
REMONUMENTATION

SEP 11 2007

SECTION

OSCODA COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970 *



For corners in

OSCODA
(County)

Located In:

Corner Code #

1. Public Land Survey

T26N

R1E

G-6

2. Property Controlling

S

in Section

S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. _____, Recorded Plat

5. Private Claims

APPROVED

County Remonumentation

Peer Review Group

WCL 25 AUG 07

JERI WINTON

OSCODA COUNTY

REGISTER OF DEEDS

08/29/2007 10:08:53AM

FEE: \$14.00

PAGES: 1 RCPT#: 5761

LC8-109 CORNER RECORDATION

Register of Deeds Stamp & File Number

I, Marvin E. Myers, P.S., in a field survey on June 4, 20 07, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-6 Quarter Section Corner common to Sections 15 & 16 of T.26N., R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set quarter Section post

Wit: Spr Pine 4" N47°E 13 lks (8.58)

Spr Pine 4" S56°W 14 lks (9.24)

Spr. Pine 4" South 358 lks (236.28

1887 Oscoda County Surveyor John Randall

Mon.- Set temp

Wit: None given

1937 GLO Dependent Resurvey Guy R. Veal Cadastral Eng.

Mon.- Proportionate distance; there is no remaining

evidence of the original post or bearing trees.

Set a concrete monument, 24 ins. long, 6 ins. diam., 18

ins. in the ground, for ¼ sec. cor., with brass tablet, 3 ½

ins. diam., 3 in. stem, embedded in top and mkd.

Wit: A Cedar, 5 ins. diam., bears N. 16° E., 49 lks

(32.34) dist., mkd. ¼ S 15 B T.

A Cedar, 5 ins. diam., bears S. 85 ¼° W., 29 lks

(19.14) dist., mkd. ¼ S 16 B T.

2001 unrecorded survey Frederick J. King PS #25852

Mon.- GLO Mon (Set 1937)

Wit: None given

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-6 Quarter Section Corner common to Sections 15 & 16 of T.26N., R.1E.

Found USGLO monument in good condition. Found no existing witnesses of record. Accepted USGLO monument as a careful

and faithful reestablishment of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-6 Quarter Section Corner common to Sections 15 & 16 of T.26N., R.1E.

Mon - Left USGLO monument in place and set two spikes along side for future magnetic detection

Wit:


N02°E 23.79' Set N&T E side 12" Cedar

N51°E 16.78' Set N&T N side 6" Cedar

S29°E 22.47' Set N&T E side 7" Cedar

S35°W 15.45' Set N&T N side 9" Cedar

North 2'± Set carsonite post

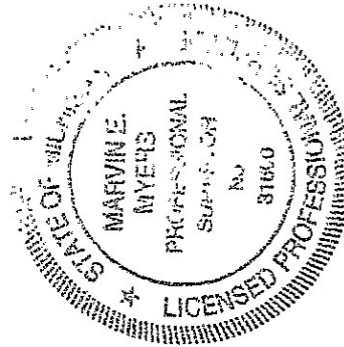

Signed by Marvin E. Myers
Surveyor's Michigan License No. 31600

Date July 27, 2007