


SURVEY &
REMONUMENTATION

SEP 11 2007

SECTION

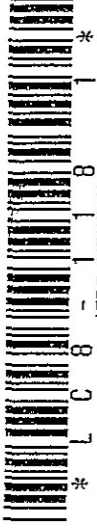

OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JERI WINTON
OSCODA COUNTY
REGISTER OF DEEDS

08/29/2007 10:09:02AM
FEE: \$14.00

For corners in

OSCODA
(County)

Located In: Corner Code #

1. Public Land Survey T26N R1E H-7

2. Property Controlling S
in Section S

3. Miscellaneous S
Property in Sec. S

APPROVED

County Remonumentation
Peer Review Group

4. Lot No. Recorded Plat
5. Private Claims

I, Marvin E. Myers, P.S., in a field survey on July 11 20 07, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
H-7 Quarter Section Corner common to Sections 15 & 22 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set quarter Section post

Wit: Spr Pine 4" N29°W 17 lks (11.22)

Spr Pine 4" S29 ½°E 7 lks (4.62)

1985 USFS J Williams, Forest Ranger

Mon.- Not given

Wit: Post set at corner

1937 GLO Dependent Resurvey Guy R. Veal Cadastral Eng.
Mon.- Proportionate distance; there is no remaining

evidence of the original post or bearing trees.

Set a concrete monument, 24 ins. long, 6 ins. diam.,

18 ins. in the ground, for ¼ sec. cor., with brass tablet,

3 ½ ins. diam., 3 in. stem, embedded in top and mkd.

Wit: A Jack Pine, 8 ins. diam., bears S. 55 ¼° W., 78 lks.

(51.48) dist., mkd. ¼ S 22 B T.

A Jack Pine, 7 ins. diam., bears N. 47 ¾° W., 93 lks.

(61.38) dist., mkd. ¼ S 15 B T.

Corner fall 31 lks South of fire lane E-W

2001 unrecorded survey Frederick J. King PS #25852

Mon.- Fnd Rec GLO Mon

Wit: None given

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

H-7 Quarter Section Corner common to Sections 15 & 22 of T.26N.-R.1E.

Found USGLO monument in good condition, 19' south of centerline of Randall Road; found USFS witness location post.

Accepted USGLO monument as a careful and faithful reestablishment of the position of the original government corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
H-7 Quarter Section Corner common to Sections 15 & 22 of T.26N.-R.1E.

Mon - Left USGLO monument in place and placed two spike along side for future magnetic detection


Wit: S43°E 5.52' Set N&T SW side 6" cedar post w/location tag

S57°W 13.03' Set N&T SE side 10" J Pine

N05°E 37.16' Set N&T W side 6" Cedar fence post

S84°W 21.83' Set N&T S side 8" Oak

S87°E 28.80' Set N&T N side 19" Oak

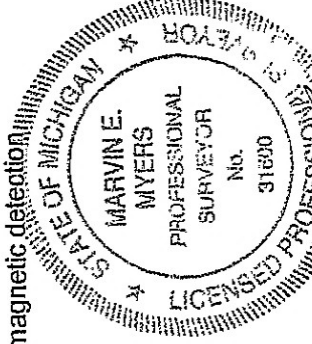

Marvin E. Myers

Signed by
Surveyor's Michigan License No. 31600

Date Sept 27, 2007