

SURVEY &
REMONUMENTATION

SEP 11 2007

SECTION

OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 *



For corners in

OSCODA _____
(County)

Located In: Corner Code #

1. Public Land Survey

T26N R1E I-3

2. Property Controlling

S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. _____, Recorded Plat

5. Private Claims

ALL 25 AUG 07

I, Marvin E. Myers, P.S., in a field survey on April 23, 20 07
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on
this certificate.

A. Description of original monument and accessories and/or subsequent
restoration:

I-3 Section Corner common to Sections 2, 3, 10, & 11 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set post Corner Sections 10, 11, 2, 3

Wit: Spr Pine 4" N39°E 10 lks (6.60)

Spr Pine 5" S54 ½°E 8 ½ lks (5.61)

1885 Oscoda County Surveyor John Randall

Mon.- Not given

Wit: None given

1887 Oscoda County Surveyor John Randall

Mon.- Int'd .02 North of an accepted Section Corner post

Wit: None given

1908 Fargo Eng Co

Mon.- Indicates found

Wit: NBT Sp Pine 6" N67 ¼°E 48 lks (31.68)

Sp Pine 6" S23 ¾°E 95 ½ lks (63.03)

Part A continued on back:→

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-3 Section Corner common to Sections 2, 3, 10, & 11 of T.26N.-R.1E.

Found USGLO concrete monument with brass cap; found utility pole N51°E 59.29; found concrete plat monument East 33.00;
found Cedar post West 1.6±; found ¾" pipe in centerline of gravel N-S road West 25± and South 0.5± from USGLO monument.
Accepted USGLO monument as a perpetuation of the original government corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
I-3 Section Corner common to Sections 2, 3, 10, & 11 of T.26N.-R.1E.

Mon - USGLO concrete monument with brass cap left in place

Wit: N65°E 59.29 found nail and tag in utility pole

S85°E 33.15 concrete plat monument


S67°W 1.6± Cedar post

S89°W 25.01 ¾" pipe in centerline of gravel N-S road

West 0.5± Carsonite post

N21°E 20.08 Set nail & tag in 6" J Pine

S24°E 6.66 Set nail & tag in 8" J Pine

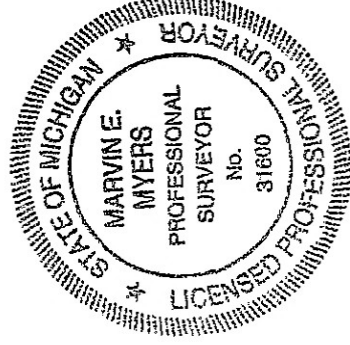

Signed by _____
Surveyor's Michigan License No. 31600

Date

August 22, 2007