

2133

1994 PRESQUE ISLE COUNTY STATE OF MICHIGAN REMEDIES IN ISLE COUNTY
RECORDED

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

94 SEP 12 AM 10:40

For corners in
Presque Isle
(County)

James M. Spang
REGISTER OF DEEDS

Located In: _____ Corner Code #

1. Public Land Survey	T	36N	R	2E	M-10
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S				
	S				
3. Miscellaneous Property in Sec.	S				
	S				

LIBER 311 PAGE 234

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, James A. Beck in a field survey on JULY 27, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereto as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-10
1856:

Original monumentation in Government Resurvey. Set post at quarter section and referenced:
Hemlock 9" N74°W 32 Links
Sugar 11" S57.5°W 35 Links

(circa 1972) 3/4" x 4 1/2' pipe
Notes from Survey by References:
Doyle Engineering N 46°30' E 86.28' 7" Maple (clump of 3)
furnished by S 77°30' E 7.71' 4" Balsam
James Granger, S 36°00' W 17.87' 5" Balsam
Granger & Associates N 80°00' W 21.36' 4" Twin W. Pine


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-10
1994:

Found 3/4" iron pipe by single proportionate measure and three witnesses from survey notes by Doyle Engineering (1972).
Witnesses found (as noted):
N46°30' E 86.28' 7" Maple (clump of 3)
S77°30' E 7.71' 4" Balsam
S36°00' W 17.87' 5" Balsam

Ratified by Peer Group
in accordance with P.A. 345

Chairman *Delwood E. Porter*
Date August 27, 1994

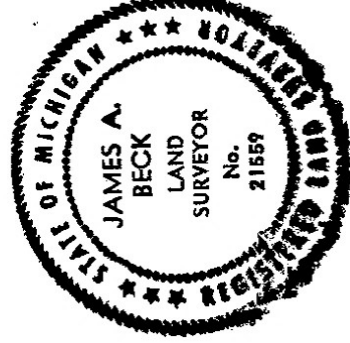

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-10
1994:

3/4" pipe and cap P.S. 21559 approximately 40' West of brushed traverse line.
Witnesses:

{r} N46°E (r) 86.28' (m) 87.23' 24" Fused Triple Sugar Maple (P.R.)*
{r} S77°30' E 7.71' (m) S75°E 7.70' 9" Balsam (P.R.)*
{r} S36°00' W 17.87' (m) S35°W 17.83' 12" Balsam (P.R.)*
S15°W 48.32' 11" White Pine*
N17°E 36.74' 9" Hemlock*

P.R. = Previously Recorded
* = Set tag P.S. 21559

Signed by *James A. Beck*

Date August 25, 1994

Surveyor's Michigan License No. _____ 21559

2459