



2019L0010
FILED
12/13/2019 01:35 PM
DIANE L. ENGLEBRECHT
MASON COUNTY
REGISTER OF DEEDS

2019 Mason County Remonumentation Project

Land Corner Recordation Certificate

Attachment B to 2019 Annual Grant Agreement

Authority: MCL 54.205 and R54.202

This form is **ONLY** for corners filed under the 2019 State Survey and Remonumentation Grant Agreement

Filing Requirement: MCL 54.268(2)(a), 54.268(2)(d), 54.201 – 54.210d and 2019 State Survey and Remonumentation Grant Agreement

Surveyors Name: **Rex E. Pope**

Field Survey Date: **05/08/2019**

For corner in: County: **Mason** Municipality Name: **Sheridan Township**

Corner Type	Survey Township	Corner Code
Original Public Land Survey Corner	T 19 N R 15 W	J01
• MCL 54.202(g)	T R	
• MCL 54.262(g)	T R	
Property Controlling Corner	S T R	
• MCL 54.202(i)	S T R	
• MCL 54.262(h)	S T R	
Protracted Public Land Survey Corner	T R	
• MCL 54.202(k)	T R	
• MCL 54.262(i)	T R	

1	A	B	C	D	E	F	G	H	I	J	K	L	M	1
2		6		5		4		3		2		1		2
3														3
4		7		8		9		10		11		12		4
5														5
6		18		17		16		15		14		13		6
7														7
8		19		20		21		22		23		24		8
9														9
10		30		29		28		27		26		25		10
11														11
12		31		32		33		34		35		36		12
13														13
	A	B	C	D	E	F	G	H	I	J	K	L	M	

Part A: Corner History.

J01: North ¼ Corner for Section 2, T19N-R15W, Sheridan Township, Mason County, Michigan.

This corner not set by GLO.

Part B: Surveyor's Report on Perpetuation, Restoration, Reestablishment or Monumentation of Corner.

J01: Corner for Section 2, T19N-R15W, Sheridan Township, Mason County, Michigan.

I set this corner by Single Proportionate measure from I01 to K01, T19N-R15W. I found nothing at this location. Witness #1 is gone. I found nothing to dispute this location for the corner.

Part C: Field Evidence for Perpetuation or Monumentation of Corner.

J01: N ¼ Corner for Section 2, T19N-R15W, Sheridan Township, Mason County, Michigan.


I set a ¾"x40" rebar with a 2" aluminum cap stamped "2019 and 39093" by single proportionate measure. This corner is accepted as a careful and faithful re-establishment of the position of the original location for this corner.
Bearings are Magnetic
#1 N05°W 20.32' Set 60d spike in NW face of 10" Maple
#2 N72°E 25.56' Set 60d spike in N face of 10" Maple
#3 S63°E 3.88' Set 60d spike in NE face of 8" Maple
#4 West 26.51' Set 60d spike in N face of 8" Maple
West 17.15' to J13, T20N-R15W
East 2626.32' to K01, T19N-R15W
West 2626.32' to I01, T19N-R15W

Date of Observation	Latitude	Longitude (W)	Datum and Adjustment Year	Epoch Date
05-08-2019	44°04'37.7912"	86°04'11.7076"	NAD 83 2011	2010

Method for coordinate determination: The Geodetic Coordinates were determined by static GPS observation and adjusted by OPUS rapid static. The coordinates were verified by RTK measure from an adjusted base point.

Disclaimer: The Latitude and Longitude reported hereon was observed using global positioning methods with an estimated positional accuracy of 1 foot, more or less, reported at the time of the observation. The reported Latitude and Longitude is a navigational accessory to the approximate corner position and should not be used to reestablish the corner position or be used in establishing property boundaries.

I, **Rex E. Pope**, in a field survey on 05/08/2019, certify under the requirements of the State Survey and Remonumentation Act, 1990 PA 345, MCL 54.261 to 54.279, and the Corner Recordation Act, 1970 PA 74, MCL 54.201 to 54.210d, that the corner(s) identified and described hereon has been perpetuated or monumented as described in Parts A, B, and C above, pursuant to the laws and rules of the State of Michigan.



12/12/2019


Rex E. Pope

Date

Professional Surveyor's License No.: 39093

Lakeshore Land Surveying, 6008 Bryant Road, Ludington, Michigan 49431

I, **Rex E. Pope**, state that the corner identified and described hereon and perpetuated or monumented as described in Parts A, B, and C above was presented to and reviewed by the Peer Review Group on **August 19, 2019** and is accepted for filing in the Mason County Remonumentation Program.

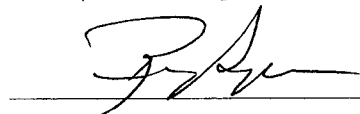

12/12/2019

Rex E. Pope

Date

Professional Surveyor's License No.: 039093