

MAR 16 2003

NEWAYGO COUNTY REMONUMENTATION PROGRAM
CORNER APPROVED BY PEER GROUP ON DECEMBER 15, 2004
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Newaygo
(County)Located in:
Goodwell Township

Corner Code #

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED & RECORDED
02/25/2005 9:26:27 AM

1. Public Land Survey SEC 33 T 14N R 11W

G-11

2. Property Controlling In Section S
3. Miscellaneous S
Property in Sec. S

VOL. 4

231

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, James J. Keller, in a field survey on November 3, 2003, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

4th Quarter 1837, John H. Mullett, Deputy Surveyor GLO. "North between Sections 33 & 34. At 59.80 chains (3946.80') W. Oak 10" dia. At 80 chains (5280') Set post cor. of Secs. 27, 28, 33 & 34."
8" W. Oak S27°E 22 links, (14.52')

November 30, 1999, Charles E. Fricke, RLS #21781 (Survey Libar 377, Page 3142) "NE cor Sec 33"
7" Maple S36°E 7.24'
10" Oak N55°W 33.39'
Gaves S266.4' West to NW corner 5237.5'
North to NE corner Sec 28 and 5180.3'
East to SE corner Sec 27

NOT
ACCEPTED

December 14, 1999, Charles E. Fricke, RLS #21781 (LCRC #1347) "G-11 Found no existing physical evidence of a monument in the vicinity of this corner location. Newaygo County Surveyor's office has no information regarding the location of this corner subsequent to the original government survey in 1837. Established corner location in North-South wire fence at intersection of said fence with the Easterly extension of an old wire East-West fence line found along the North line of Section 33. Set 4" dia. concrete monument."
Nail in West side 7" Maple S36°E 7.24'
Nail in SW side 10" Oak N55°W 33.39'

NOT
ACCEPTED

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

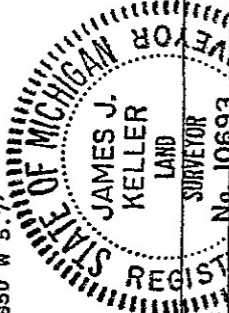
November 3, 2003, James J. Keller, RLS #10693. Searched for but did not find either evidence of post or of bearing trees. Set 1"Ø x 18" IP at intersection of remains of old fence wire in ground to East remains of old fence wire in ground to West (30 locations) and remains of N-S fence. dug for but did not find anything at this location. Found 4" dia. concrete monument in N-S fence line S00°23'47"E 91.10 feet.

Set 60d E side 6"-4"-6" White Oak Clump N29°W 11.08'
Set 30d SE side 8" Red Oak N50°E 25.42'
Set 30d W side 10" Red Oak S16°E 18.81'
Set 30d SE side 16" Red Oak S50°W 5.7'

C. Description of monument for corner and accessories established to perpetuate localing the position of the corner:

Accepted intersection of old fence remains as best available evidence of the location of the original corner. And set Harrison Monument to replace 1"x18" IP

Set 60d E side 6"-4"-6" White Oak Clump N29°W 11.08'
Set 30d SE side 8" Red Oak N50°E 25.42'
Set 30d W side 10" Red Oak S16°E 18.81'
Set 30d SE side 16" Red Oak S50°W 5.7'

Signed by James J. Keller Date December 16, 2004

Surveyor's Michigan License No. 10693

Approved by Peer Review Group on December 15, 2004

Norman L. Ochs, County Representative

M. S. O.