

SURVEY &
REMONUMENTATION

JAN 23 2007

Instrument
200600009299 DR
Liber Page
7 26

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

WEXFORD
(County)

Located In: Corner Code #

1. Public Land Survey

T 23N	R 12W	G-7
T	R	
T	R	
T	R	
T	R	
T	R	
T	R	
T	R	

2. Property Controlling
in Section

S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, George D. Smith, in a field survey on Sept 8, 2006 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-7 Section Corner Common to Sections 15, 16, 21, 22


1839 GLO Section Post by John Brink, Deputy Surveyor, set post witnessed by: 1) Beech 12 S30E 20, 2) Beech 10 N61E 17 1898 A.J. Teed Survey in section 22, liber 1 page 319, stake ok and both witnesses, distance to G-8 measures 39.78 chains, distance centerline of Rail Road to South noted as 10.68 chains
1909 Fargo Engineering Co. section map, and field book 24 page 47 " found gas pipe 18" in ground, easily pulled up, replaced with gas pipe 34" long with sand and lime." section map notes" found iron bar used by Surveyors and property owners, 3) Maple stp. N87E 0.22, 4) Bk. Cherry N43W 0.32, distance to H-7 measures 39.67, distance to G-6 measures 38.84 3/4, distance F-7 measures 39.89 1/2, distance to G-8 measures 39.82
1958 MSHD Government Witness Corner Card, liber 2 page 913 (recorded in 1977) found 1" pipe, 5) S27E 4" Red Pine 19.88', 6) S51W 17" Elm 38.11', 7) S34W 18" Tw. Cherry 65.34', 8) N71W Fe. Post 31.50', 9) N7E 20" Elm 66.80'
1972 Erickson PS#16929 LCRC, liber 1 page 183, found Fargo Engineering rod and accepted, 5) S27E 4" Red Pine 19.88', 6) S51W 17" Elm 38.11', 7) S34W 18" Tw. Cherry 65.34', 8) N71W Fe. Post 31.50', 9) N7E 20" Elm 66.80'
1972 Erickson PS#16929 Cert. of Survey, liber 249 of Deeds page 965, found mon., witnesses same as MSHD corner card, survey shows iron set 12.00' South and East of corner.
1974 J.L Wilcox PS#14102 Cert. of Survey, liber 1 page 285, corner noted no witnesses given
1979 J.L Wilcox PS#14102 Cert. of Survey, liber 1 page 795, corner noted, witnesses same as MSHD corner card
1985 J.L Wilcox PS#14102 Cert. of Survey, liber 2 page 146, conc. mon, witnesses same as MSHD corner card
1988 J.L Wilcox PS#14102 Cert. of Survey, liber 67 page 336, conc. mon, witnesses same as MSHD corner card
2005 Curtis PS#43048, LCRC, liber 6 page 360, and Cert. of Survey liber 581 page 1107, found 1/2 iron rod in 1in. pipe buried 5 in., 10) East 12.00' Rod/PS cap 14102, 11) S85E 18.56 8" N. Pine, 12) N55W 32.48' 20" Twin W. Pine, 13) S45W 43.34' 22" Maple

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2" iron with cap#16938 in center of 1 1/4" X 40" pipe, excavated below pipe in search of lime but found nothing. Corner compares with both the Teed and Fargo distances to G-8, 2627.72' measures vs. 2628.12' Fargo, 2625.48' Teed and with Fargo's distance to G-6 2560.45' measures vs. 2584.10' Fargo and to corner H-7 2615.44' measure vs. 2618.22' Fargo. Pipe also matches 7 and 9 from the 1958 MSHD and witnesses 11-13 from the 2005 LCRC. Placed a 5/8" X 36" iron in center of the existing pipe and accepted as the best available evidence of the position of the original corner being the Section corner common to sections 15, 16, 21, and 22 T23N-R12W

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X36" iron with Wexford County brass cap stamped: 39098, 2006, 15, 16, 21, 22, in center of existing pipe
S34W 43.34' 24" Maple, found nail (13)
S20W 64.65' Center of Twin 20" Cherry (7)
N62W 32.48' Twin 22" White Pine, found nail (12)
S78E 18.52' 12" Red Pine, found nail (11)
S06E 43.81' NW Corner of House at ground level
N06E 66.6' Face of Twin Elm Stump (9)
East 12.00' 1/2" Iron with cap#14102 (10)

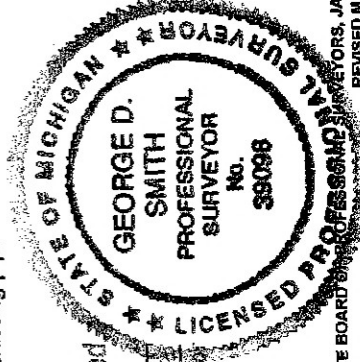

Peer Group Reviewed and Approved

Date: 1 Dec 06
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

Signed by George D. Smith
Surveyor's Michigan License No. 39098

Date 12-1-06