

DATE OF

RECORDATION

MAY 16 1997

RECORDATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

MANISTEE
(County)

Located In:

Corner Code #

1. Public Land Survey

T 23N R 13W
T R
T R
T R
T R
T R
T R
T R

M-9

2. Property Controlling

S
S
S
S

in Section

3. Miscellaneous

Property in Section

REGISTER'S OFFICE
MANISTEE COUNTY
#96-355 AT 4.23 p.m.
AUG 16 1996

Penney A. Repora
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, John C. Schulte, in a field survey on May 24th, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original survey established in 1838 by J. Brink.

Set a wooden post with the following references:

- (1) Hemlock 14" S10°W 49 lks.
(2) Hemlock 13" N36°W 19 lks.

In 1909, Fargo found no evidence and prorated between M-7 and M-11. Set iron in lime and the following corner references:

- (3) Hemlock 16" N18°W 0.25 ch
(4) Sugar 14" S62°W 0.51 ch
In 1978, Carl Roser recovered a large square concrete monument 1'x1' with 2" iron pipe extending 2 feet above ground. Set cedar post with location tag. No wit. available. Dyke

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1' square concrete monument with 2" iron pipe in center of monument extending up to 3 feet above ground on slope of Hopewyl Dam. Concrete dyke wall is 44 ft. East. No references recovered.

Measurements to corners to the North and South:

M-7 N0°18'29"E 5205.06 feet (Roser measurement from M-8 to M-7 & new measurement from M-9 to M-8)

M-8 N0°18'09"E 2620.79 feet (measured)

M-10 S0°21'11"W 2626.20 feet (measured)

M-11 S0°23'49"W 5249.26 feet (measured)

Corner M-02

ratified by the Manistee County Peer Group

according to the county plan adopted pursuant to P.A. 345 of 1990

as amended, (being the State Survey and Remonument Act, MCL 54.261

et seq.) . Date of Peer Review: _____


Anthony M. Schulte 2 1996

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted the monument as the properly restored corner and the best available evidence of the original corner. The following new corner references:

- | | | |
|----------------|-------|------------|
| (5) Sign post | East | 12.15 ft. |
| (6) Power Pole | S25°W | 275.28 ft. |
| (7) Power Pole | N83°W | 131.29 ft. |
| (8) Power Pole | N53°W | 312.39 ft. |
| (9) W. Pine | N74°W | 291.98 ft. |
| (10) W. Pine | S85°W | 289.79 ft. |

Recovered position is accepted as a careful and faithful reestablishment of the position of the original corner by the Manistee County Remonumentation Peer Group.

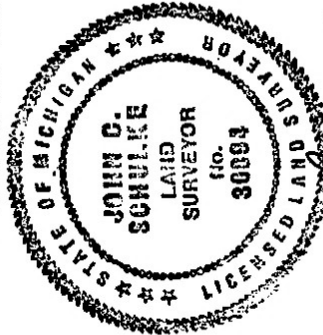

Signed by *John C. Schulte*

Surveyor's Michigan License No. 30894

Date June 3, 1996