



DELIVERED TO NEWAYGO CO
02/06/2015 12:28:34 PM

2014 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: _____ Corner Code # _____

1. Public Land Survey

T14N R11W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W

VOL. 8

79

2. Property Controlling in Section S
3. Miscellaneous S
Property in Sec S



STEWART K. SANDERS
NEWAYGO COUNTY REGISTER OF DEED
RECEIVED AND RECORDED
02/06/2015 12:30:23 PM

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

Register of Deeds Stamp & File Number

I, Norman L. Ochs, in a field survey on December 19, 2014 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

One Quarter Corner common to Sections 10 and 11, T14N R11W, Goodwell Township

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO
J H Mullett, November 13, 1837
Set quarter section post
#1 12" Beech S28°E 25 links (16.5')
#2 10" Beech S86°W 19 links (12.54')
Ash & Elm swamp 33' North

Daniel E. Schripsema, R L S #24617
Job Number 98161
Found a concrete monument
#6 6" Oak West 8.00'
#5 14" Oak N45°W 43.61'
#7 6" Maple S20°E 31.70'
#3 16" Twin Oak N15°E 26.33'

Patrick A. Salisbury, R.L.S. # 13594
Field notes dated May 22, 1972, Job Number. S72034
Set monument (found rocks laid on end)
#3 12" Twin Oak N15°E 26.37'
#4 12" Oak S30°E 32.73'
#5 8" Oak N45°W 43.91'
nail in West side
nail in East side
nail in NE side

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:


I found a 4" diameter Concrete Monument with 1/2" Rerod projecting 6"± above grade. No apparent occupation to the North, South, East and West The South edge of a bog is 40'± North. The condition of the witnesses are as follows #1 and #2 gone, #3 in good condition, #4 found nail in East side of 12" diameter stump S23°E 32.61', #5 thru #7 in good condition.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I accepted the 4" diameter Concrete Monument with 1/2" Rerod projecting 6"± above ground and added a plastic cap with #22349 as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original Quarter Corner.
#3 16" Black Oak (with blaze) N15°E 26.22'
#5 18" Black Oak N48°W 43.81'
#6 8" Black Oak (with blaze) S86°W 8.01'
#7 12" Black Oak (with blaze) S22°E 31.56'
Set 40d nail with tag in West side
Set 40d nail with tag in Northeast side
Found nail with tag in South side
Set 40d nail with tag in West side

Signed by Norman L. Ochs
Norman L Ochs

Date February 6, 2015

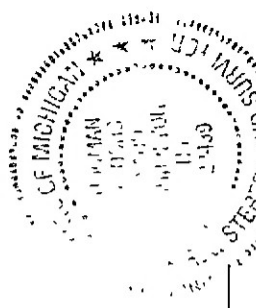

Surveyor's Michigan License No 22439

Form approved by Michigan State Board of Land Surveyors, Jan 28, 1971
Revised May 14, 1975
Revised Jan , 1983

Approved by Peer Review Group on December 8, 2014
Norman L. Ochs, County Representative

N.L.O.