

SURVEY & REMONUMENTATION

MAR 19 1998

1997 Newaygo County Remonumentation Project

SECTION

For corners in
Newaygo
(County)

Located in:

Corner Code #

1. Public Land Survey

T 15N R 11W
T R
T R
T R
T R
S T
S T
S T
S T

L-3

2. Property Controlling in Section

3. Miscellaneous Property in Sec.

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Norman L. Ochs, in a field survey on November 8, 1997, do hereby certify that under requirements of P. A. 74, Michigan P. A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

Note: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

North One Quarter Corner, Section 12, Lincoln Township, Newaygo County, Michigan.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

G.L.O. Milton Nye Resurvey 1856
12" Beech N50°W 40 Links (26.40')#1
10" Beech S02°W 26 Links (17.16')#2

William M. Jacques (County Surveyor)
Book B, Page 36 September 12, 1908
Stone

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

Found a ¾" Pipe by 20" long on old fence line on ground going South. The centerline of the East and West blacktop road is 1 foot South. The condition of the recorded witnesses are: #1 and #2 gone.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

Removed ¾" Pipe and set 4" diameter Harrison cast iron monument 20" long marked "County Survey" as a substantial marker for the section corner and is accepted as a careful and faithful reestablishment of the original corner.

24" Red Oak N30°W 58.23' (blazed) Found spike in East side of tree.
16" Red Oak N17°E 58.58' Found spike in East side of tree.

Power Pole S11°W 47.47' Set spike and brass washer #22439 in West side of pole.

22" Forked Hickory (blazed) S28°E 105.70' Set spike and brass washer #22439 in West side of tree.

Signed by Norman L. Ochs

Norman L. Ochs


Date November 10, 1997

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on November 11, 1997
Norman L. Ochs, County Representative.

M.L.O.

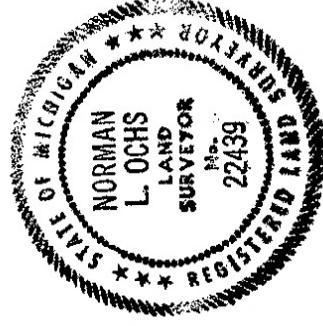

MINI
NEWAYGO COUNTY DEEDS
RECEIVED FROM DEEDS
LINBA H. BROWN
'98 MAR 6 PM 12:30
Shirley M. Brown

VOL. 2 138

Register of Deeds, Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1	-	6	-	5	-	4	-	3	-	2	-	1	-
2	-	6	-	5	-	4	-	3	-	2	-	1	-
3	-	6	-	5	-	4	-	3	-	2	-	1	-
4	-	7	-	8	-	9	-	10	-	11	-	12	-
5	-	7	-	8	-	9	-	10	-	11	-	12	-
6	-	18	-	17	-	16	-	15	-	14	-	13	-
7	-	18	-	17	-	16	-	15	-	14	-	13	-
8	-	19	-	20	-	21	-	22	-	23	-	24	-
9	-	19	-	20	-	21	-	22	-	23	-	24	-
10	-	30	-	29	-	28	-	27	-	26	-	25	-
11	-	31	-	32	-	33	-	34	-	35	-	36	-
12	-	31	-	32	-	33	-	34	-	35	-	36	-
13	-	31	-	32	-	33	-	34	-	35	-	36	-