

SURVEY & REMONUMENTATION

MAR 16 2005



SECTION

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED & RECORDED
02/25/2005 9:26:27 AM

2004 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: Corner Code #

VOL. 4 271

- 1. Public Land Survey T15N R11W L-5
T N R W
T N R W
T N R W
T N R W
- 2. Property Controlling S
in Section S
- 3. Miscellaneous S
Property in Sec. S

- 4. Lot No. _____ Recorded Plat _____
- 5. Private Claims _____

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Norman L. Ochs, in a field survey on June 30, 2004, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

North One Quarter corner of Section 13, Norwich Township, Newaygo County

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO resurvey, Quarter Section Post
 3rd Quarter 1856 reestablished old 12" diameter Beech
 corner
 Robert A. Griffin, RLS#13584
 1974 Found square stone on end
 #1 48" White Pine stump 14.15'
 #3 6" Maple S29°W 3.40'
 #4 10" Red Oak N75°E 36.60'

OVER

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found a stone 4" square on top, 24" long and 4" x 6" on bottom. No apparent occupation to the North, South, East or West
The condition of the witnesses are as follows: #1 found remains of large pine stump N33°W 14.5'± to center, #2 is gone, #3 and #4 are in good condition.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I removed the stone and reset inverted North of quarter corner. I set a 4" diameter Harrison cast iron monument 30" long marked "County Surveyor #22439" in the exact location that was occupied by the stone, as a substantial marker for the quarter corner and is accepted as a careful and faithful perpetuation of the position of the original corner.

- #3 10" Maple S24°W 3.35'
- #4 14" Red Oak N71°E 36.44'
- 10" Red Oak N33°W 18.90'
- 18" Red Oak S70°E 25.00'

- Set 40d spike with tag in NW side
- Set 40d spike with tag in NW side
- Set 40d spike with tag in NE side
- Set 40d spike with tag in SW side


Set a 1/2" x 18" re-rod with cap no. 22439 at the intersection of centerline Pere Marquette Railroad (abandoned) and the North and South 1/4 line South 187.26'

Signed by Norman L. Ochs
Norman L. Ochs

Date September 22, 2004

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

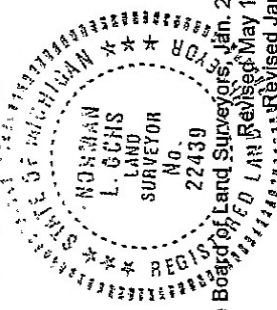

Approved by Peer Review Group on September 15, 2004
Norman L. Ochs, County Representative.

M.L.O.