

**SURVEY &
REMONUMENTATION**

MAR 02 2009



DELIVERED TO NEWAYGO CO
02/05/2009 3:11:56 PM

2008 Newaygo County Remonumentation Project

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: Corner Code #

1. Public Land Survey


T15N	R11W
T15N	R10W
T N	R W
T N	R W
T N	R W
T N	R W
T N	R W
T N	R W
T N	R W

M-10 ✓
A-10

VOL. 6 182

2 Property Controlling
in Section S _____

3. Miscellaneous
Property in Sec. S _____

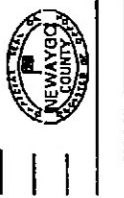

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED AND RECORDED
02/05/2009 3:19:08 PM

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Norman L. Ochs, in a field survey on October 27, 2008 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

East One Quarter Corner, Section 25, T15N R11W, Norwich Township, Newaygo County.
West One Quarter Corner, Section 30, T15N R10W, Big Rapids Township, Mecosta County.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO - Resurvey
John Hodgson, 3rd quarter 1838
Set quarter section post
#1 8" Maple S58°W 32 links (21.12')
#2 6" Beech N42°W 23 links (15.18')

Stuart A. Lakanen, R.L.S. # 21573 DID NOT HONOR POSITION
LCRC recorded in Liber 1, Page 106 - Mecosta County Register of
Deeds

February 28, 1975

Set by single proportionate measure between A-9 and A-10; no
evidence available.

- ¾" x 3' Iron Rod
- #3 8" Oak AZ 47° (N47°E) 14.2'
- #4 10" Oak AZ 142° (S38°E) 18.4'
- #5 14" Oak AZ 332° (N28°W) 38.5'

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found a ¾" Rod as set by Stuart A. Lakanen, R.L.S. # 21573, 33.51' North and 10.84' West of an equal distance position and a ½" Rerod with plastic cap as set by Gerald J. Gray, R.L.S. # 17741, 31.68' North and 6.86' West of an equal distance position. I did not honor either monument and set a 4" diameter Harrison Cast Iron Monument 30" long marked "County Surveyor # 22439", equal distance and online between M-9 and M-11, (M-10 to M-9 measured equals, 26'14.75", M-9 to M-11 measured equals 26'14.75"). A cable fence to the North is 12± West No apparent occupation to the South. A cable fence to the East is 36± North. No apparent occupation to the West. The condition of the witnesses are as follows: #1 and #2 gone, #3 thru #9 not for this corner position. The Lakanen and Gray location for this corner were based on different positions for the M-9 and M-11 corners. Therefore, I used the Remoned corners to work from


C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I set a 4" diameter Harrison Cast Iron Monument 30" long marked "County Surveyor # 22439", equal distance and online between M-9 and M-11 (position determined by R.R. Bischer, R.L.S. # 52469 using GPS) to project 4± above grade as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original Quarter corner.

- 12" Red Oak S22°E 43.32' Set 40d spike with tag in West side
- 12" Red Oak S40°W 37.09' Set 40d spike with tag in Northwest side
- 8" dead - 12" Twin Red Oak N5°W 17.68' Found spike with tag # 17741 in East side
- 18" Red Oak East 6.22' Set 40d spike with tag in North side

Signed by Norman L. Ochs
Norman L. Ochs

Date February 3, 2009

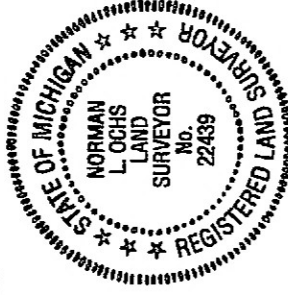

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on November 5, 2008
Norman L. Ochs, County Representative