



DELIVERED TO NEWAYGO CO.
01/29/2014 2:08:21 PM

2013 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in: Corner Code #


VOL. 7 274

1. Public Land Survey

T14N R11W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W
T N R W

C-9

2. Property Controlling
in Section
3. Miscellaneous
Property in Sec.

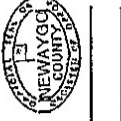

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED AND RECORDED
01/29/2014 3:30:21 PM

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Norman L. Ochs, in a field survey on November 25, 2013 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

One Quarter Corner common to Sections 29 and 30, T14N R11W, Goodwell Township

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO - Resurvey
J.H. Mullett, November 18, 1837
Set post corner
#1 24" Elm N26°W 18 links (11.88')
#2 12" Maple S47°W 14 links (9.24')

Delos G. Anderson, County Surveyor
Book A, Pages 221 - 222 1897-1898
#3 36" Pine S71°W 64 links (42.24')

Newaygo County Road Commission Sheet 1950's±

2" Gas Pipe
#4 12" White Ash West 7.9'
#5 36" Pine Stump S31°W 42.2'
#6 14" Hemlock S40°W 27.5'
Patrick R. Leemon, R.L.S. # 31595
Section 20 section break and on witness card
Found 2" Gas Pipe 1' out of ground
#7 8" Cedar N82°E 3.67'
#8 8" Sugar Maple N31°E 23.87'
#9 9" Ash N86°W 23.58'

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found a 2" Iron Pipe projecting 12"± above grade. No apparent occupation North, South and West. The corner is online with steel "T" fence posts to the East. The corner is in a swamp. The condition of the witnesses are as follows: #1 thru #5 gone, #6 found 16" diameter stump S36°W 28"± to center, #7 found 8" diameter tree lying down N82°E 3.5'± to stump hole, #8 thru #9 gone.


C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I drove the 2" Iron Pipe down to project 4"± above grade and set a 3/4" x 40" galvanized pipe with a 2" diameter cast iron cap marked "Survey Marker" inside the 2" Iron Pipe to project 12"± above grade as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original Quarter Corner.

- 12" Maple West 23.50'
- 8" Hemlock N45°E 36.13'
- 10" Cedar N10°W 41.34'
- 10" Hemlock S15°W 28.61'
- 6" Gray Birch S88°E 24.81'

- Set 40d spike with tag above overgrown spike in North side
- Set 40 spike with tag in Southeast side
- Set 40d spike with tag in West side
- Set 40d spike with tag in West side
- Set 40d spike with tag in South side

Signed by Norman L. Ochs Date JAN 27, 2014
Norman L. Ochs

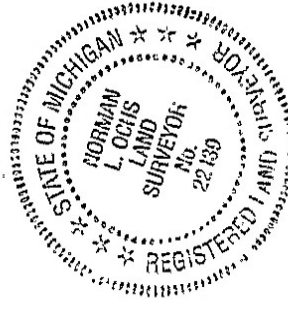

Surveyor's Michigan License No. _____ 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on November 11, 2013
Norman L. Ochs, County Representative.

M.L.O.