

SURVEY &  
REMONUMENTATION

FEB 0 8 2008



DELIVERED TO NEWAYGO CO.  
01/22/2008 3:43:01 PM

SECTION 2007 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Newaygo  
(County)

Located in: Corner Code #

**VOL. 5 350**

1. Public Land Survey

T13N R11W  
T N R W  
T N R W  
T N R W  
T N R W  
T N R W  
T N R W  
T N R W

E-7

2. Property Controlling

S  
S  
S  
S

LINDA M. LANDHEER  
NEWAYGO COUNTY REGISTER OF DEEDS  
RECEIVED AND RECORDED  
01/22/2008 4:03:22 PM

3. Miscellaneous  
Property in Sec.

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_

Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Norman L. Ochs, in a field survey on November 8, 2007 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.**

Section corner common to Sections 16, 17, 20 and 21, Big Prairie Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO - James H. Mullett  
4<sup>th</sup> Quarter 1837  
Set post corner  
#1 36" Pine S42°E 16 links (10.56')  
#2 24" White Oak N44°W 72 (47.52')

William M. Jacques, County Surveyor  
Book B, Page 34, 1908  
Stone with broken glass under stone  
  
Lyle S. Shepherd, R.L.S. #503  
Book 59A, Pages 6 and 7, December 17, 1925  
Found stone in road  
#3 18" White Oak N72°30'E 20.5 links (13.53')  
#4 12" White Oak S30°30'W 75.7 links (49.962') OVER ↘

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:


I found a 6" diameter vitrified clay tile filled with concrete with top broken off, 22± below grade that was raised with a 1" x 18" iron pipe and a ½" x 4" re-rod to flush with bituminous. The centerline of the North and South bituminous road is 2± East of the corner. The corner is online ± with East and West tree row. The condition of the witnesses are as follows: #1 thru #3 gone, #4 good, #5 thru #8 gone.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I referenced position and removed re-rod and iron pipe prior to road project. After completion of road project I set a 4" diameter Harrison cast iron monument 16" long marked "County Surveyor #22439" directly above clay tile in a monument box as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original Section corner.

#4 30" White Oak S28°W 50.82'  
SW corner concrete slab of frame bldg #2390 N75°E 103.10'  
12" Cherry West 77.29'  
36" White Oak S10°E 188.86'

Found spike with tag (stamped Sec. corner) in SE side  
Set 40d spike with tag in South side  
Set 40d spike with tag in East side

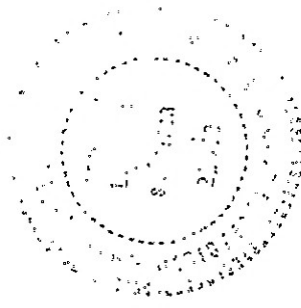

Signed by Norman L. Ochs  
Norman L. Ochs

Date January 14, 2008

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971  
Revised May 14, 1975  
Revised Jan., 1983

Approved by Peer Review Group on November 28, 2007  
Norman L. Ochs, County Representative.

M.L.O.