

MAR 04 2003

2002 Newaygo County Remonumentation Project

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Newaygo
(County)

Located in:

Corner Code #

VOL. 3

325

- 1. Public Land Survey
T13 N R11 W
T N R W
T N R W
T N R W
T N R W
- 2. Property Controlling in Section
S
- 3. Miscellaneous
S
S
S
- Property in Sec.
S
T N R W
T N R W

F-5

LINDA M. LANDHEER
NEWAYGO COUNTY
REGISTER OF DEEDS OFFICE
19 FEB 2003 11:27:32 AM
RECEIVED & RECORDED

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Norman L. Ochs, in a field survey on January 25, 2002, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Corner common to Sections 9 and 16, Big Prairie Township, Newaygo County, Michigan

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

G.L.O. James H. Mullett 1837

- #1 36" Pine S66°W 16 links (10.56')
- #2 24" Pine N16°W 54 links (35.64')

Lyle S. Shepard RLS #503
July 15, 1926

- Set Tile - Replaced Stake and found both Government bearing tree (stumps)
- #1 36" Pine Stump S66°W 16 links (10.56')
- #2 24" Pine Stump N16°W 54 links (35.64')
- #3 14" White Oak N72½°W 41 links (27.06')
- #4 4" White-Pine S52°E 50¼ links (33.17')

OVER ↵

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I found a ½" x 20" Iron Pipe raised with a ¾" x 18" Iron Pipe raised with a ½" x 22" Pinch Pipe. The centerline of an East-West bituminous road is 4.5' North. The corner is on-line with a remnants fence to the South and with the East edge of a Pine Plantation to the North. The condition of the recorded witnesses are as follows: #1 thru #5 gone, #6 thru #9 good condition, #10 did not verify, #11 thru #14 good condition.


C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I removed the ½" x 20" Iron Pipe raised with a ¾" x 18" Iron Pipe raised with a ½" x 22" Pinch Pipe and set a 2¾" diameter Harrison cast iron monument 20" long marked "County Survey #22439", in the exact location, flush with bituminous, and grouted in place, and is accepted as a careful and faithful perpetuation of the position of the original quarter corner.

- #6 14" White Pine (blazed) S5°E 35.30' Set spike with tag in West side
- #9 Power Pole N17°E 119.10' Found spike with tag #30389 in West side
- #11 24" White Oak (blazed) N71°E 65.00'
- #13 4" diameter Concrete Monument with ½" Re-rod S7°W 49.72'
- #14 14" White Pine (blazed) S31°W 71.51' Found spike in West side

Signed by Norman L. Ochs
Norman L. Ochs

Date February 20, 2002

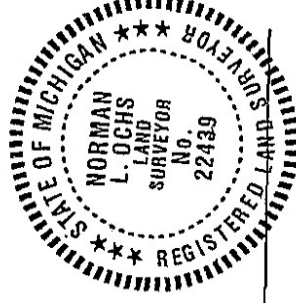

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on July 24, 2002
Norman L. Ochs, County Representative.

N.L.O.