

**JAN 25 2001**

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

**SECTION**

**RECORDED  
LAKE COUNTY, MI.**

For corners in  
Lake \_\_\_\_\_

**LIBER 004 PAGE 0258  
MAY 5 10 27 AM '00**

Located in: \_\_\_\_\_ Corner Code# \_\_\_\_\_

1. Public Land Survey  
T 18 N R 14 W G-11  
T R  
T R  
T R
2. Property Controlling S T R  
in Section \_\_\_\_\_
3. Miscellaneous S T R  
Property in Sec. \_\_\_\_\_
4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_
5. Private Claims S T R  
\_\_\_\_\_

*Robert S. Wetherell*

**REGISTER OF DEEDS**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on March 15, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**G-11 - Section corner common to Sections 27, 28, 33 & 34, T18N, R14W**

**A. Description of original monument and accessories and/or subsequent restoration:**

- 1838 - S. Sibley, G.L.O.**  
"20 Pine for corner"
- 1919 - G. H. Johnson, Co. Sur.**  
Pipe  
#1 - 24" Pine Stub S81°W 27.0'  
#2 - 20" Pine Stub S35°E 27.0'
- Undated - R. Luunde, P.E.**  
" 1/2" Bent Iron in place"  
#3 - 8" B. Oak N61°30'E 52.5'
- Undated G. H. Johnson**  
#4 - 9" Tw. B. Oak S65°W 139 Links  
#5 - 6" Maple S25°E 183 Links  
#6 Large stone N72°E 35 Links
- 1952 - G. Blass, LS 5489**  
"Found musket barrel at base of 30" W. Pine Stump this stump corresponds with pine corner tree as per Gov't notes. Distance North to river also is compatible with Gov't notes".  
#7 - 12" W. Oak S5°E 111.23'  
#8 - 14" W. Oak N45°E 83.70'  
#9 - 8" W. Oak N51°W 56.65'
- "Corner removed by M.M. Buck, LS 228, in Sept. 1956. Since replaced with steel fence corner post".

- 1962 - G. Shadko, LS 1934**  
"Found 3/4" iron pipe and 1/2" bolt with square nut replaced with 4" pipe filled with cement and capped brass plate"  
#10 - 10" W. Oak S72°E 95.5'  
#7 - 12" W. Oak S6°W 111.8'  
#11 - 28" W. Pine Stump S55°W 1.8'  
#12 - 8" W. Oak N55°E 2.5'  
#13 - 8" W. Oak N40°W 6.1'
- 1964 - R.A. Griffin, LS 13584**  
L.C.R.C. - Liber 01, Pg. 118  
#8 - 14" W. Oak N45°E 84.40'  
#12 - 8" W. Oak N52°E 2.45'  
#10 - 9" W. Oak S73°E 95.54'  
#7 - 13" W. Oak S2°W 111.48'  
#13 - 7" W. Oak N40°W 6.25'
- #14 - "X" in Boulder S26°W 47.40'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner**

I found the 4" Concrete Monument by Shadko 37 feet more or less South of an East and West road.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Gone, #6 Found large stone N65°E 25' more or less, #7 Found S9°W, #8 Found in good condition, #9 Gone, #10, Found in good condition, #11 Found remains, #12 Found in good condition, #13 Found in good condition, #14 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I accepted the 4" pipe filled with cement as a substantial marker for the corner, and is accepted as a careful and faithful perpetuation of the position of the original corner.


- 11" W. Oak N52°E 2.45' (dock spike in N.W. side) #12
- 13" W. Oak S68°E 95.51' (dock spike in S.E. side) #10
- 15" W. Oak S9°W 111.48' (dock spike in S.E. side) #7
- 10" W. Oak N40°W 6.25' (dock spike in N.E. side) #13

QUALIFIED BY THE LAKE COUNTY REVIEW GROUP

IN ACCORDANCE WITH MICH. P.A. 345

CR. NUMBER R-X.W.

DATE 4-11-2000

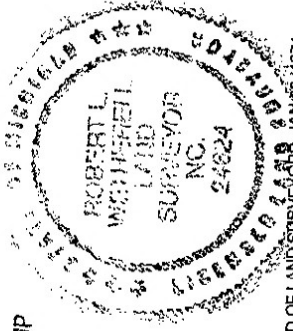

Signed by

*Robert S. Wetherell*

Surveyor's Michigan License No. 24624

Date April 12, 2000

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 28, 1971  
REVISED JAN 14, 1975  
REVISED JAN 14, 1983

ADAPTED FOR WORD PROCESSING JANUARY, 1999