


SURVEY &
REMONUMENTATION

SEP 11 2007

SECTION

OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1976

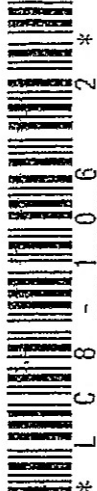

For corners in

OSCODA
(County)

Located In: Corner Code #

1. Public Land Survey

T26N R1E G-3

2. Property Controlling S
in Section S
3. Miscellaneous S
Property in Sec. S

T26N R1E G-3

T26N R1E G-3

T26N R1E G-3

T26N R1E G-3

T26N R1E G-3

T26N R1E G-3

4. Lot No. _____, Recorded Plat
5. Private Claims

I, Marvin E. Myers, P.S., in a field survey on April 23, 2007, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-3 Section Corner common to Sections 3, 4, 9, & 10 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set post Corner Sections 9, 10, 3, 4

Wit: Y Pine 28" S33°E 69 lks (45.54)

Spr Pine 12" N56°W 1.52 chns (100.32)

1908 Fargo Eng Co

Mon.- Not given

Wit: NBT Sp. Pine 12" N23°W 38 ½ lks (25.41)

NBT Sp. Pine 12" N80 ¾°E 49 ½ lks (32.67)

1884 Oscoda County Surveyor John Randall

1887 Mon.- Not given

1888 Wit: None given

1912 Oscoda County Surveyor C.O. Seeley

Mon.- Post established by river survey

Wit: NBT Sp P 12" N23°W 38 ½ lks (25.41)

NBT Sp P 12" N80 ¾°E 49 ½ lks (32.67)

APPROVED

County Remonumentation

Peer Review Group

Part A continued on back:→

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-3 Section Corner common to Sections 3, 4, 9, & 10 of T.26N.-R.1E.

Found ½" bar and cap #10696 one foot West of the West edge of a N-S trail road and 33 East of the USGLO witness corner Monument; found 60d Nail in E Face 8" B Oak S47°E18.78; found 60d Nail in SE Face 9" J Pine S19°W 14.78;

found 60d Nail in N Face 8" B Oak S48°W 36.89; found 60d Nail in W Face 14" B Oak N26°W 35.03 Accepted 1/2" bar and cap #10696 as a careful and faithful reestablishment of the position of the corner. Replaced ½" bar and cap with a 5/8"x34" steel rebar with Oscoda County cap.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-3 Section Corner common to Sections 3, 4, 9, & 10 of T.26N.-R.1E.

Mon - 5/8"x34" steel rebar with Oscoda County cap.

Wit: Corner is one foot West of the West edge of an N-S trail road and 33 East of the USGLO witness corner monument.

S47°E 18.78 Found 60d Nail in E Face 8" B Oak

S19°W 14.78 Found 60d Nail in SE Face 9" J Pine

S48°W 36.89 Found 60d Nail in N Face 8" B Oak

N26°W 35.03 Found 60d Nail in W Face 14" B Oak


West 33.00 Found USGLO concrete monument w/brass cap

Wits to USGLO Witness Corner:

S76°E 48.50 Found 60d Nail in E Face 8" B Oak

S14°E 23.05 Found 60d Nail in N Face 8" B Oak

East 33.00 Found ½" rebar with cap #10696

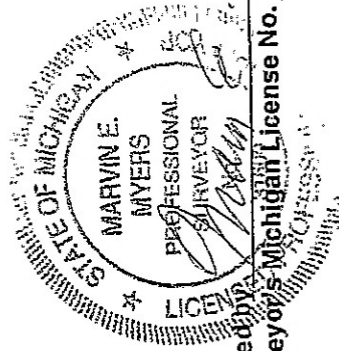

Signed by Marvin E. Myers
Surveyor's Michigan License No. 31600

Date August 7, 2007