

SURVEY &
REMONUMENTATION

SEP 1 1 2007

SECTION

OSCODA COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1971

For corners in

OSCODA
(County)

Located In:

Corner Code #

1. Public Land Survey

T26N

R41E

I-6

2. Property Controlling

S

T

R

I-6

APPROVED

3. Miscellaneous

S

T

R

I-6

County Remonumentation

Property in Sec.

S

T

R

I-6

Peer Review Group

1122 25 AUG 07

4. Lot No. _____, Recorded Plat

5. Private Claims

I, Marvin E. Myers, P.S., in a field survey on April 24 20 07, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-6 Quarter Section Corner common to Sections 14 & 15 of T.26N.-R.1E.

1839 GLO William R. Coon Deputy Surveyor

Mon.- Set quarter Section post

Wit: Spr Pine 4" N11 ½°E 15 lks (9.90)

Spr Pine 4" N35 ¼°W 20 lks (13.20)

1928 USFS B.C. Snoesbeck Forest Ranger

Mon.- 4" pine stake 24" above ground

Wit: No bearing trees. Corner sits in JP about 20 ft East of road

1912 Oscoda County Surveyor C.O. Seeley

Mon.- Set ¼ post between Sec 14-15

Wit: NBT Spr pine 6" S75 ½°E 26 lks (17.16)

Part A continued on back:→

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-6 Quarter Section Corner common to Sections 14 & 15 of T.26N.-R.1E.

Found USFS concrete monument with brass cap # 13584; found 4" R Pine N72°W 55.55; found 3" R Pine S43°W 91.34; found nail in NE side Power Pole S20°E 90.20; found nail in North side Cedar Post East 32.86 Accepted USFS concrete monument as a careful and faithful reestablishment of the position of the corner. In centerline of N-S Knott Road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-6 Quarter Section Corner common to Sections 14 & 15 of T.26N.-R.1E.

Mon - USFS concrete monument with brass cap left in place, set two spikes on alongside for magnetic attraction.


Wit:

N72°W 55.55 Found nail and tag in S side 13" R Pine with USFS location tag

S43°W 91.34 Found nail and tag in N side 13" R Pine with USFS location tag

S20°E 90.20 Found nail and tag in NE side Power Pole with USFS location tag

East 32.86 Found nail in North side Cedar Post with USFS location tag

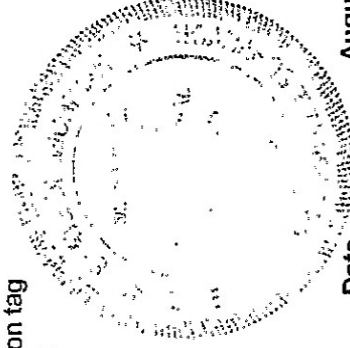

Signed by Marvin E. Myers
Surveyor's Michigan License No. 31600

Date

August 21, 2007