

SURVEY &
REMONUMENTATION

AUG 24 2006

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Oscoda Located In: Corner Code #
(County)

Liber 7 pgs 245-246

FILED

At 9:10 o'clock A.M.

Date 8-14-2006

Clerk/Register of Deeds
Oscoda County, Michigan

Register of Deeds Stamp & File Number

1. Public Land Survey T 26 N R 1 E K-5
T R
T R
T R
T R
2. Property Controlling S
in Section S
3. Miscellaneous S
Property in Sec. S

4. Lot No. , Recorded Plat
5. Private Claims

I, Marvin E. Myers, in a field survey on Jan 17, 2006 hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration

K- 5 T26N, R1E

1839 USGLO Coon, DS

Mon - Set Post

W/it: 10" Birch S36°30'E 41 lks

6" Aspen N36°W 33 lks

No Date County Surveyor entry

Mon - Fd. Seeley's Post & W/it's

Set an iron pipe

W/it: Oak N50°30'E 65.8 feet

Oak S42°W 112.4 feet

1937 Guy Veal CE

Mon - Set Concrete mon. at inter. roads, and fence west

W/it: Fd 10" B. Oak N51°30'E 98 lks

Found 8" W. Oak S40°30'W 174 lks

Set "WC" Conc. Mon. N89°42'W 50 lks

Mkd 16" B. Oak N25°30'E 387 lks

Mkd 8" B. Oak S72°15'E 262 lks

Mkd 7" R. Pine S33°30'W 610 lks

Mkd 8" J. Pine N57°W 63 lks

1942 R. J. Black, #3384

Mon - Fd. USGLO mon.

W/it: None given

1943 G. Henning #2240

Mon - Fd. USGLO mon.

W/it: WC USGLO Conc

Mon West 33.0

(History continued on back of this sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

K- 5 T26N, R1E Found 5/8" rebar in monument box. Placed Oscoda County Cap on 5/8" bar; found Nail & tag #31605 in P. Pole S84°W 39.88; found Nail & tag #31605 in 9" R Pine N70°W 57.17; found Nail & tag #31605 in Cor. Fence Post S45°E 49.00; found Nail & tag #31605 in P. Pole N74°E 86.43 Accepted 5/8" bar as the best available evidence of the position of the Government Corner. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K- 5 T26N, R1E

Mon - 5/8" rebar with Standard Oscoda County cap in pavement monument box.

W/it: Nail & tag #31605 in P. Pole S84°W 39.88

Nail & tag #31605 in 9" R Pine N70°W 57.17

Nail & tag #31605 in Cor. Fence Post S45°E 49.00


Nail & tag #31605 in P. Pole N74°E 86.43

Set nail & tag in the N. side of a 6" Maple due East 28.20'

Set nail & tag in the SW. side of a 12" R. Oak S50°E 9.76'

Set nail & tag in the SE. side of a 10" R. Oak S10°W 4.86'

Set nail & tag in the S. side of a 8" Maple N60°W 15.15'

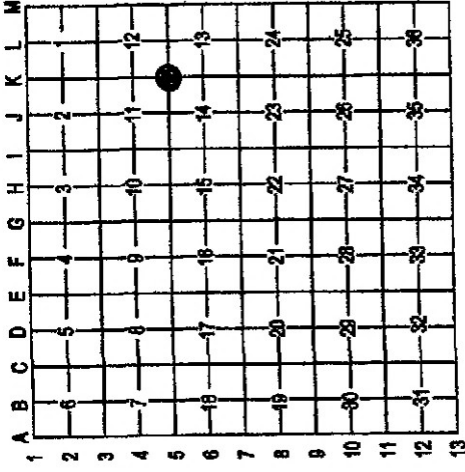

1955 Shadko, PE #1934

Mon - Not given

W/it: none given


Section retraction survey

APPROVED

County Remonumentation

Peer Review Group

NEL 31 JULY 06

Signed by  MARVIN E. MYERS
Surveyor's Michigan License No. 31600
PROFESSIONAL SURVEYOR
No. 31600

Date July 18, 2006