SURVEY & REMONUMENTATION

JAN 14 2008

SECTION

* 2 0 0 8 L 0 0 9 0 *

2008L0090
FILED
01/02/2008 02:48:21PM
DIANE L. STARK
MASON COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in MASON (County) Located in: Corner Code #

1. *Public Land Survey* T 19N R 15W — K-2
2. Property Controlling *in Section* S__ T__ R__
3. Miscellaneous Property in Sec. S__ T__ R__
4. Lot No. ____, Recorded Plat ____
5. *Private Claims* ____

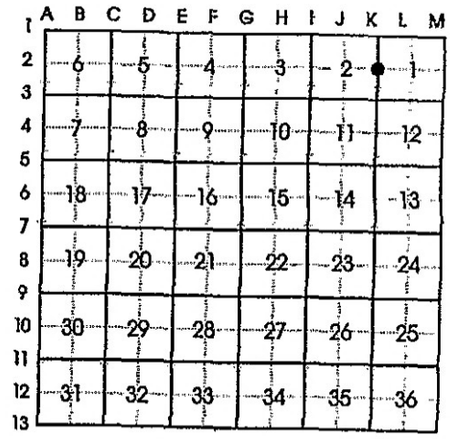

I, Kenneth L. Ross, in a field survey on September 29, 2007, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: ***Not more than 4 corners, all in the same town and range, may be recorded on this certificate.***

A. Description of original monument and accessories and/or subsequent restoration:
K-2 1/4 corner for Sections 1 and 2, T19N-R15W.

1838, Slyvester Sibley, G.L.O., subdivion survey
Set post at 40 chains, Stream call at 31.50 chs. (2079')
#1 Cedar 7" N 16° W 10 lks. (6.60')
#2 Cedar 6" S 42° E 9 lks. (5.94')

2006, Rex Pope, PLS # 39093 *(Act 132, file # 2006-060115)*
Set South 1/16th corner for Section 1 & 2 T19N-R15W.
1/2" rerod with PLS cap.

2001, Craig R. Stapley, PLS #46887 (Act 132, file # M1-0931)
Found no evidence of corner, calculated position *on line between Section Corner.*
Show a distance of 2690.46', North from K-3 & 2985.28' North to K-1. Prorated Measured vs. G.L.O.
Note; No monument was set, this area is a wet swamp.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
K-2 *1/4 corner for Sections 1 and 2, T19N-R15W.*

I, Kenneth L. Ross, Mason County Surveyor and Kevin Pritchard (survey tech.) retraced Craig Stapley's 2001 cadastral survey of section 2, T19N-R15W, we found Rex Pope, bar and cap, set during a property survey in 2006, file no. 060115, Rex set South 1/16th corner for Section 1 & 2, using Stabley's Section break, Rex testified to us that he did not recovery any evidence of an existing 1/4 corner(K-2). We double over the distance to Pope's Bar & Cap to the Section corner (K-3), we GPS the two corners and measured 1345.14 feet, GPS bearing of N 02 – 40' – 28" W, which fits Stabley's distance as recorded. We also searched the area, but found no evidence of old fence lines – witness trees or markers. Measured distance, South to K-3 is 2690.28 feet. Note G.L.O. Stream call fits well, we measured 2100 feet to South bank of the Sauble River.

Condition of recorded witnesses are as follows; #1 Found 10" stump at N 37° W – 18.4 feet #2 Gone

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
K-2 1/4 corner for Sections 1 and 2, T19N-R15W.

We set a 3/4" x 72" Gas Pipe at 2690.28 feet North of K-3, on a straight line thru Pope's Bar & Cap, we place a 5/8" x 24" rerod with a 2 1/2" Aluminum cap, set inside the Pipe, the cap is stamped MASON COUNTY MONUMENT, K-2, PLS# 17634, 2007. The Pipe is 2.0 above swamp grade. This corner is accepted as a careful and faithful location for the position of the original corner.

New witn. #3 Maple 8" S 14° W 104.21' (set 60d spk in NW side of tree)
New witn. #4 Maple 5" S 20° W 140.78' (set 60d spk. in NW side of tree)
New witn. #5 Maple 5" N 35° W 44.79' (set 60d spk. in SW side of tree)
New witn. #6 Maple 5" growing out of 16" stump N 85° W 62.26' (set 60d spk. in South side of tree)

Signed by Kenneth L. Ross Date Dec. 28, 2007

Surveyor's Michigan License No. 17634

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING MARCH, 1993

MASON COUNTY REMONUMENTATION PEER GROUP APPROVAL
APPROVAL DATE 12-13-2007
Kenneth L. Ross
KENNETH L. ROSS, CHAIRMAN, MASON CO. REMON. COMMITTEE

STATE OF MICHIGAN
KENNETH L. ROSS
LAND SURVEYOR
No. 17634
REGISTERED LAND SURVEYOR