

SURVEY &
REMONUMENTATION

FEB 1 1 1998

RECEIVED

1997 DEC 11 AM 9:28

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

WEXFORD
(County)

Located in: Corner Code #

WEXFORD COUNTY, MI
REGISTER OF DEEDS

1. Public Land Survey

T 23N R 12W E-13

2. Property Controlling in Section
3. Miscellaneous Property in Sec.

S
S
S
S

4. Lot No. , Recorded Plat

5. Private Claims

Register of Deeds Stamp & File Number

I, CRAIG J. PULLEN, in a field survey on MAY 20, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- E-13 1838 G.L.O. SURVEY BY J. BRINK, WOOD POST, BEECH 10 N77E 14, W. PINE 18 N47W 18
1973 J. L. WILCOX, PS #14102 L.C.R.C. L. 2, P. 634 FOUND 1½" PIPE WITH COUPLING AND PLUG, SET WEXFORD COUNTY MONUMENT, S30°W 12" OAK 26.23', S40°E 8" OAK 49.76', N40°E 6" RED PINE 48.39'
1977 J.L. WILCOX #14102 L.C.R.C. L. 3, P. 155 FOUND WEXFORD COUNTY MONUMENT N35°W 44.62' 10" RED PINE, N30°E 75.21' 6" RED PINE, S26°W 26.18' 20" OAK, S40°E 49.77' 18" OAK
1988 J.L. WILCOX & ASSOC. BY D. SCHRIPSEMA, PS #24617 L. 67, P. 354 FOUND WEXFORD COUNTY MONUMENT N35°W 44.62' 10" RED PINE, N30°E 75.21' 6" RED PINE, S26°W 26.18' 20" OAK, S40°E 49.77' 18" OAK

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- E-13 FOUND WEXFORD COUNTY MONUMENT IN POOR CONDITION IN CENTERLINE OF 14 ROAD AND 4 PREVIOUS WITNESSES. ALSO FOUND OLD CEDAR POST N19°W 34'. REMOVED WEXFORD COUNTY MONUMENT AND SET 5/8" X 36" IRON & BRASS CAP IN THIS POSITION. THIS CORNER IS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE CORNER.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- E-13 SECTION CORNER COMMON TO SECTIONS 32 & 33, T23N, R12W, AND SECTIONS 4 & 5, T22N, R12W
5/8" X 36" IRON WITH BRASS CAP STAMPED: CJP, 39095, 1997, 32, 33, 4, 5
N29°W 10" WHITE PINE 39.01'
N34°E 8" RED PINE 75.24'
N44°E 12" RED PINE 48.57'
S32°E 24" TWIN OAK 49.84'

Peer Group Reviewed and Approved

Date: 30 Oct 97

Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

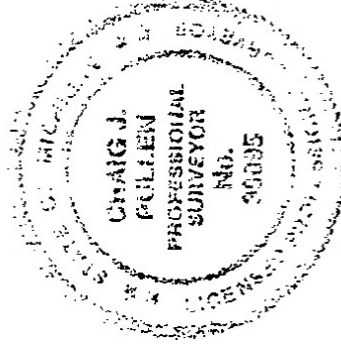

Signed by Craig J. Pullen

Surveyor's Michigan License No. 39095

Date 2 Dec 97

LIBER

05 PAGE 23