

SURVEY &
REMONUMENTATION

SEP 29 1994

COMMISSION

For corners in

Oscoda

(County)

Located in:

Corner Code #

1. Public Land Survey

T 26N R 2E

C - 11

2. Property Controlling
in Section

S S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Marvin E. Myers, in a field survey on July 7, 1994,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

GLO-July 1839 Coon

Mon-Post

WIT: 25" Y.Pine S52°W 28 lks.

20" Y.Pine N12°E 46 lks.

April 1911 C.O. Seeley

Mon.-Set Temp. Post

GLO-Oct. 1935 Guy Veal

Mon-3½" Brass Tablet in 6" Conc. Mon.

WIT: 14" Norway Stump N19½°E 143½ lks.

12" B.Oak S62½°W 35 lks.

4" W.Pine N24½°W 35 lks.

14" Norway S23½°W 144 lks.

4" W.Pine N37½°W 72½ lks.

Date Unknown S.J.E. Lucas, Jr.

Mon-GLO Cor. (replaced) 1" Iron

Pin for Cor.

WIT: 4" Pine N37½°W 47.20' (US GLO)

4" N.Pine S11½°W 95.00' (US GLO)

4" W.Pine S63°W 37.90' (NBT)

10" B.Oak S46°E 57.10' (NBT)

Dec. 1963 N.Caldwell

Mon-Set ½" Pipe (from Lucas witness)

WIT: GLO BT (stump) N37°W 47.20'

P.Pole S20°W 76.20'

8" N.Pine N75°W 61.40'

22" Oak S40°E 53.80'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

Found ½" Pipe 12" long verified position by measurement to accessories of record and is accepted as a careful
and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.

Mon-Set Standard Oscoda County Monument in Mon. Box

WIT: Fd. ½" Pipe & Cap LS #12018 West 25.90'

Fd. 10" Norway Pine N75°W 61.40'

Fd. Power Pole S20°W 76.20'

Fd. 22" (now 27") W.Oak S40°E 53.80'

Centerline N-S road East 7.20'±

APPROVED

County Remonumentation
Peer Review Group

Signed by Marvin E. Myers Date Aug 24, 1994

Surveyor's Michigan License No. 31600

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971
REVISED MAY 14, 1971


STATE OF MICHIGAN
OSCODA COUNTY
FILED

14 SEP 94 11:06 A.M.

PATSY J. PETERS
REGISTER OF DEEDS

L 3 Pg 276

Register of Deeds Stamp & File Number

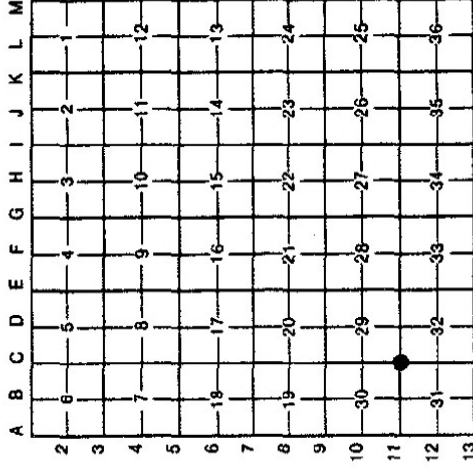

LCRC L.I., pg.37 Dec. 1972 N.Caldwell
Mon-Set ½" Pipe
WIT: GLO Stump N37°W 47.20'
P.Pole S20°W 76.20'
22" Oak S40°E 53.80'
8" N.Pine N75°W 61.40'

1960 Oscoda County Road Comm. Plans
Mon-Unknown
WIT: None given
Corner at Station 157+45.3

