

SURVEY &
REMONUMENTATION

SEP 29 1994

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

COMMISSION

Oscoda _____
(County)

Located In:

Corner Code ##

1. Public Land Survey

T 26N R 2E

E - 11

2. Property Controlling

S

in Section

S

3. Miscellaneous

S

Property in Sec.

S

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Marvin E. Myers, in a field survey on July 11, 19 94,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

GLO-July 1939 Coon

GLO-1935 Guy Veal

Mon-Post

WIT: 4" Spruce Pine N25°E 22½ lks.

4" Spruce Pine S16°W 20 lks.

April 1911 C.O. Seeley

Mon-Post from old BT

WIT: NBT 8" Spruce Pine N70½°E 70 lks.

Mon-Fd. C.O. Seeley 1½" Pipe

Replaced with 3½" Dia Brass Tablet

in 6" Conc. Cyl. 6"x24"

WIT: Fd. NBT Stump Hole N25°E 22½ lks.

Fd. 10" J. Pine N70°E 70 lks.

10" J. Pine N09½°E 146 lks.

4" J. Pine S34 3/4°E 66 lks.

5" J. Pine S44½°W 109 lks.

5" J. Pine N59½°W 81 lks.

L.L., pg. 400 Nov. 1973 N. Caldwell
Mon-GLO Conc. Mon

WIT: 8" J. Pine N60°E 17.45'

12" J. Pine S10°E 28.45'

12" J. Pine N64°W 53.00'

A	B	C	D	E	F	G	H	I	J	K	L	A
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found US GLO 6" Concrete Monument with 3½" Dia. Brass Tablet, and is accepted as a careful and
faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon-GLO Mon. with 1" Pipe beside 2' Forest Service Marker Post lying on ground

WIT: Nail N side 7" Oak S45°E 10.50'


Nail E side 4" J. Pine S30°E 31.85'

Nail S side 3" J. Pine S65°W 19.11'

Nail NW side 7" Oak N19°E 16.63'

APPROVED

County Remonumentation
Peer Review Group

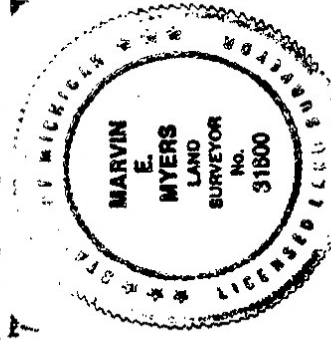

Signed by Marvin E. Myers

Date

Aug 29, 1994

Surveyor's Michigan License No. 31600