

SURVEY &  
REMONUMENTATION

SEP 29 1994

For corners in  
COMMISSION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

L-3 Pg 293  
STATE OF MICHIGAN  
OSCEOLA COUNTY  
FILED

Oscoda  
(County)

Located In:

Corner Code #

- |                         |            |        |
|-------------------------|------------|--------|
| 1. Public Land Survey   | T 26N R 2E | E - 12 |
|                         | T          | R      |
|                         | T          | R      |
|                         | T          | R      |
|                         | T          | R      |
| 2. Property Controlling | S          |        |
| in Section              | S          |        |
| 3. Miscellaneous        | S          |        |
| Property in Sec.        | S          |        |

14 SEP 94 11:10 A.M.

PATSY J. PETERS  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

I, Marvin E. Myers, in a field survey on July 8, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

GLO-July 1839 Coon  
Mon-Post  
WIT: 10" Aspen S30 3/4°W 17 lks.  
10" Spruce N20°W 12 lks.  
  
Sept. 1914 C.O. Seeley  
Mon-3/4"x24" Pipe  
WIT: NBT 12" Y.Pine S47°W 1.36½ lks.  
  
GLO-1935 Guy Veal  
Mon-3½" Dia. Brass Tablet;  
3" stem in 6" Dia.; 24" Long  
Conc. Mon.  
WIT: 6" Poplar N27 3/4°E 21 lks.  
6" B.Oak N75 3/4°W 53 lks.  
  
LCRC L.2, pg.234 Apr. 1969 N.Caldwell  
Mon-Fd, US GLO Mon.  
6' South of E-W Fence  
41' East of N-S Fence  
WIT: 8" N.Pine N60°W 22.10'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Veal reestablished corner by proportionate measure.  
Found US GLO 6" concrete monument verified position by measurement to accessories of record and is accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon-US GLO 6" concrete monument with 3½" Brass Tablet fd. 3/4" Pipe 1.5' deep S56°E 1.18'  
WIT: Set 4" Polebarn Nail in E. side 4" R.Oak N25°W 10.81'  
Set 4" Polebarn Nail in NW side 4" J.Pine S39°W 38.91'  
Set 4" Polebarn Nail in North side 15" Large Tooth Poplar East 26.34'  
Fd. 8" Norway Pine N60°W 22.10'


APPROVED

County Remonumentation  
Peer Review Group

Signed by Marvin E. Myers

Date

AUG 24, 1994

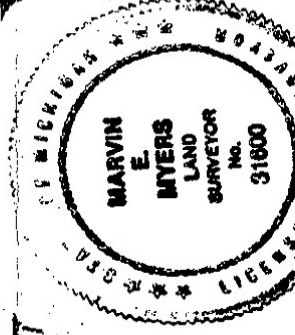

Surveyor's Michigan License No. 31600