

State of Michigan Remonumentation Program  
For Presque Isle County

PRESQUE ISLE COUNTY  
RECORDED

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

94 AUG 23 AM 10:11

For corners in

PRESQUE ISLE  
(County)

Located In: \_\_\_\_\_ Corner Code ##

*Jane M. Lamb*  
REGISTER OF DEEDS

- Public Land Survey T 36N R 2E L-13  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
- Property Controlling S \_\_\_\_\_  
in Section S \_\_\_\_\_  
Miscellaneous S \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_

LIBER **310** PAGE **938**

Register of Deeds Stamp & File Number

- Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- Private Claims \_\_\_\_\_


A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Ronald Bischer, in a field survey on April 7, 1994 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- L-13  
GLO Notes, Resurvey 1856 N42°E 50.78' 20" Spruce 1979 - Ronald Bischer  
Set Wood Post S32°E 25.21' 5" Maple ½" Rod in 2½" Pipe  
Pine 6" N55°E 9 links S39°W 86.41' 8" Cedar N42°E 50.78' 20" Spruce  
Birch 4" N70°W 25 links 1979 - Delmar E. Porter S32°E 25.21' 5" Maple  
1935 - Marcus Schaaf Found 2" Pipe, Replaced pipe S39°W 86.41' 8" Cedar  
Set 2½" Pipe with conc. mon. w/brass cap 1979 - Delmar E. Porter  
1979 - Delmar E. Porter N42°E 50.86' 14" Balsam Concrete Monument w/brass cap  
Found 2½" Pipe, set ½" Rod S33°E 25.15' Tw. 8" Maple N42°E 50.86' 14" Balsam  
in center of pipe S33°E 25.15' Tw. 8" Maple  
B. Description of corner evidence found and/or method applied in restoring or reestablishing corner: S38°W 86.40' 8" Cedar

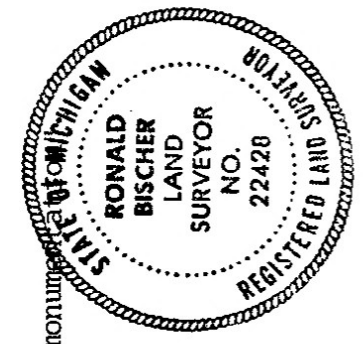

**SURVEY &  
REMONUMENTATION  
SEP 09 1994  
COMMISSION**

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- L-13  
Presque Isle County Remonumentation Monument  
S32°E 25.21' 6" Maple  
S39°W 86.41' 10" Cedar  
N47°E 31.05' 6" Maple  
N23°W 20.13' 3" Balsam fir

\*Witness tags w/nails used.

Ratified by Peer Group  
in accordance with P.A. 345  
Chairman *Delmar E. Porter*  
Date July 27, 1994

Signed by Ronald R. Bischer Date July 20, 1994  
Surveyor's Michigan License No. 22420

2263-94