

CRAWFORD COUNTY
PEER GROUP APPROVAL
Date Dec 22, 1994
Marvin E. Myers
Marvin E. Myers, P.S.

CRAWFORD COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in _____
CRAWFORD (County)

Located In: _____
Corner Code ## _____

STATE OF MICHIGAN
CRAWFORD COUNTY
RECORDED

1. Public Land Survey	T <u>28N</u> R <u>3W</u>	G-11
	T _____ R _____	
	T _____ R _____	
	T _____ R _____	
2. Property Controlling in Section	S _____	
	S _____	
3. Miscellaneous	S _____	
	S _____	

10 FEB 95 8:42 A.M.

ELIZABETH H. WIELAND
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Wayne E. Boss, in a field survey on December 8, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Walter Warner, 1857 **3/4" Bolt Set, Unknown Origin**
Reestablish old corner **A.E. Newman used G-11 in old survey but did not say what the cor. was or if he replaced cor. Used & wit. by N. Parker Cor. Cert. L. 2, pg 149**
No notes found on original cor. placement
1. 37" Poplar, S45°E, 70.04'
2. 12" Tw. Maple, S60°W, 82.66'
3. Iron pin in mon. N50°E, 47.88'

1/2" Iron Set in Mon. Box by Marvin Myers, 1991
LLRC L. 3, pg 22
2± South of ~~4~~ E-W Road.
1. Face of Concrete Project Marker Post N50°E, 46.95'
2. Found nail & tag in NE face 48" Cottonwood, S44°E, 70.04'
3. Conc. Mon. N50°E, 47.88'
4. Nail SE Face 24" Maple, S61°W, 82.65'
5. NE Cor. Stop Sign Post, N17°W, 60.29'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1/2" Ir. Fd. in Mon. Box, PS #31600
1. Fd. Conc. R/W Mon. (Bent) N45°E, 47.48'
2. Fd. MSHD Tag 40" Poplar, S47°E, 70.13'
3. Fd. Nail 12" Tw. Maple, S55°W, 82.78'
GLO Walter Warner 1857 to F-11, 2644.62', A.E. Newman 2640', Meas. 2635.00 (N. Parker) Meas. 2637.94'
GLO Walter Warner 1857 to H-11, 2632.08', Meas. 2643.60' N. Parker
GLO Walter Warner 1857 to G-11, 2698.08', 2709.75' N. Parker, 2711.30' G. Ostling, Meas. 2710.37'
GLO Walter Warner 1857 to G-12, 2646.60', Meas 2659.89'


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-11 Crawford County Monument Set in exact location of **1/4"** bar.
1. Conc. RW Mon (Bent), N45°E, 47.48'
2. MSHD Tag 40" Poplar, S47°E, 70.13'
3. Nail 12" Tw. Maple, S55°W, 82.78'
4. E. Post of Stop Sign, N24°W, 58.71'

This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

Signed by Wayne E. Boss, PS
Surveyor's Michigan License No. 20703

Date January 3, 1995

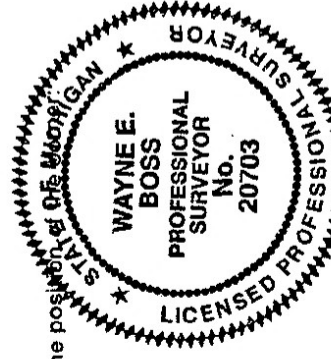

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												