

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>31</u> N. <u>•</u> , R. <u>6</u> W. <u>•</u>	<u>F-13; G-13</u>
2. PROPERTY CONTROLLING IN SECTION <u>33</u>	, T. <u>31</u> N. <u>•</u> , R. <u>6</u> W. <u>•</u>	<u>15</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____, R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

M. 210

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 8, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-13 Reestablished 1/4 corner on third correction line equidistant and on line between SE & SW of Sec. 33 T31N-R6W, these section corners being recovered corners in 1962 dept. survey. The section corner on third correction line common to Sec's 4 & 5 T30N-R6W is S89°48'30"E, 331.86'.
- G-13 Found dept. monument from previous dept. survey. Corner was found in 1962 as a RR iron on end with dept. monument added in 1962.
- 15 Established west 1/8 corner on third correction line equidistant and on line between the SW and S1/4 corners of Sec. 33, T31N-R6W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<i>1/4 sec 33</i>	F-13	G-13	15
Set DNR mon. & cedar post	Found DNR mon. & set Cedar post	Set 1"x36" pipe & cedar post w/loc. tag	
6" Maple S52°W 51.7	12" Maple N07°E 27.3	10" Maple S58°W 24.9	
9" Maple N45°W 19.5	8" Maple N84°W 16.2	5" Maple S03°E 30.2	
5" Maple N03°E 38.6	9" Maple S47°W 15.2	4" Ironwood S47°E 9.1	
on E-W Random Line	7" Maple S24°E 12.6	on E-W Random Line	

This corner was Reset on 9-27-95 by C. Kuiskila & ROTHARA-see attached

SEE CORN SEC. 33

w/8 7/8 33/4

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)



SURVEYOR'S MICHIGAN REGISTRATION NO. _____ JORDAN TOWNSHIP ANTRIM COUNTY

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>31</u> N. <u>●</u> , R. <u>6</u> W. <u>●</u>	<u>C-11; D-11; E-11</u>
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

L-1 P-211

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 18, 19 74, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-11 Found point of stake from U.S.B.T. (stump) white pine N80°E, 9.2' and remains of tamarack stump S83°W, 4'. Good original U.S. corner.
- D-11 Found 1½" pipe in place as noted on M.S.H.D. M-66 plans dated 1935. One stump remains of witness. The same data appears on page 43 of old large county surveyor's book at County Road Commission (no date).
- E-11 Restored section corner by old corner fence post, fence remains S and E. Fence corner fits U.S. distance N-S-W to found corners very reasonable and also U.S. swp. tie to N.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-11	D-11	E-11
Set DNR mon. & cedar post	Found pipe & added DNR mon. and cedar post	Set DNR mon. & cedar post
8" W. Pine S72°W 32.1	10" Tw. Maple N64°E 51.8	5" Maple N38°W 12.9
9" W. Pine N28°W 34.1	10" Maple S62°E 63.4	7" Cherry S40°W 36.5
7" Cedar N66°E 32.8	9" B. Cherry S32°W 53.3	6" Maple N51°E 21.2
10" W. Pine S03°W 47.0	15" B. Cherry N78°W 74.1	

NW SGC. 33

SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR



SURVEYOR'S MICHIGAN REGISTRATION NO. _____ JORDAN TOWNSHIP ANTRIM COUNTY

CONS. 4047
REV. 10/60

MICHIGAN
DEPARTMENT OF CONSERVATION
FORESTRY DIVISION

LAND CORNER RECORD

T. 31 N.R. 6 W.


Antrim COUNTY

DESCRIPTION OF CORNER Section corner common to Sections 33 - 34 on south boundary of township

CORNER MONUMENT Set 1" pipe with 4" brass cap

DATE MONUMENT PLACED AND WITNESSED June 28, 1962

WITNESSES TO CORNER..... 10" H. Maple N 5 E 27.2'

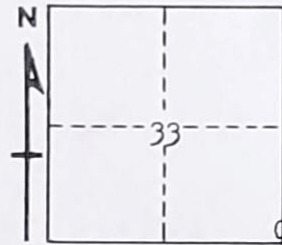

6" H. Maple N 86 W 16.3'

AND

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

This corner was found while making a survey of the Third Correction line in this township. Found 2 foot of small gauge RR rail at corner as established in very old previous survey by unknown surveyor. Unable to definitely conclude this to be an original corner, but appears to have been in existence for considerable time and was used in other surveys in this area. Checks for bearing and measurement to other corners, and must be considered the best available evidence of proper location for corner. Appears to be the only corner available for control of the correction line through this township.

SURVEYOR'S SEAL

SIGNED Kenneth J. Ostling DATE July 10, 1962
REGISTERED LAND SURVEYOR

ANTRIM COUNTY
MICHIGAN
RECEIVED FOR RECORD
Nov 30 10 50 AM '95

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

JORDAN TWP.

Wanda R. Conway
REGISTER OF DEEDS

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY <u>27</u>	T. <u>31</u> N. S., R. <u>6</u> E. W.	<u>H-11, G-11, G-9</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur L. Lennox, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on NOV 16, 1995, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on NOV 16, 1995, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

NE SEC. 33

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p>H-11 found "T" iron #23514 7" Maple S46W 1.50 8" Maple S69E 13.90 12" Maple N22E 14.14 16" Twin Maple N55E 8.90</p>	<p>G-11 found "T" iron #23514 18" Maple N8-30E 20.0 24" Maple S36E 38.0 36" Beech S86W 25.10 30" Beech S44W 19.70</p>	<p>G-9 Found 24" DBL Maple S75W 24.0 18" Basswood N20W 35.70 U.P. S20E 36.10</p>
--	---	--

SIGNED BY [Signature] DATE Nov 16, 1995

SURVEYOR'S MICHIGAN REGISTRATION NO. 20357

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR



LIRE# 002 1 Agt 277

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

2/c

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 31 N. R. 6 W.	E-12; E-13
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	32, T. 31 N. R. 6 W.	XX = on line & equidistant between C-12 & 10, Sec. 32
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

pg. 209

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 7, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on November 7, 1974, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-12 Found 2"x24" galv. pipe w/bolt in top in place. Added DNR mon. No history of corner, except it appears to have been used as basis of staking small parcels in W $\frac{1}{2}$ SW $\frac{1}{4}$ Sec. 33.
- E-13 Corner on third correction line common to Sec's 32 & 33 T31N-R6W, was recovered and accepted in previous dept. survey, dated 1962 (1" axle shaft). The N $\frac{1}{4}$ corner of Sec. 5 T30N-R6W is S89 $^{\circ}$ 48'30"E, 323.22'.
- XX Established SW corner of N $\frac{1}{2}$ NW $\frac{1}{4}$ SW $\frac{1}{4}$ of Sec. 32 at S00 $^{\circ}$ 05'20"E, 653.4' from W $\frac{1}{4}$ Sec. 32.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-12	E-13	XX
Set DNR mon. & cedar post	Fd. 1" iron (axle shaft) & set cedar post	Set 1 $\frac{1}{2}$ "x36" pipe & cedar post w/loc. tag
5" Balsam N23 $^{\circ}$ W 36.40	12" B. Cherry S14 $^{\circ}$ W 55.7	10" Cedar N20 $^{\circ}$ E 32.7
5" Spruce N88 $^{\circ}$ E 14.24	8" Maple N02 $^{\circ}$ W 26.3	6" Cedar N56 $^{\circ}$ E 20.4
5" Spruce S27 $^{\circ}$ W 33.43	10" B. Cherry N71 $^{\circ}$ E 36.2	9" Cedar N52 $^{\circ}$ W 44.4
N-S Random Due W 3'	on Random E-W-N	N-S Random Due E 3.8

w/4 sec. 33

SW CORN SEC. 33

SIGNED BY Carl F. Roser 9-15-76 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

JORDAN TOWNSHIP
ANTRIM COUNTY

